## Airport Movement Area Safety System (AMASS) Operational Test, Final Report

Dan Dellmyer

December 2000

DOT/FAA/CT-TN00/27

Document is on file at the William J. Hughes Technical Center Library, Atlantic City International Airport, NJ 08405



U.S. Department of Transportation Federal Aviation Administration

William J. Hughes Technical Center Atlantic City International Airport, NJ 08405 DISTRIBUTION STATEMENT A Approved for Public Release

Approved for Public Releas
Distribution Unlimited

20010514 084

#### NOTICE

This document is disseminated under the sponsorship of the U.S. Department of Transportation in the interest of information exchange. The United States Government assumes no liability for the contents or use thereof.

The United States Government does not endorse products or manufacturers. Trade or manufacturers' names appear herein solely because they are considered essential to the objective of this report.

RE VOSULETE	TIONS AF	DTIC Form 50 PREVIOUS EDITIONS ARE VESULETE
200	2. Retun	UNLIMITED
³ )10	DIIC:	2. DISTRIBUTION STATEMENT
514	5. Do not for 6 to	DOT/FAA/CT-TN00/27 Dellmyer, D.  D. PREPARED UNDER CONTRACT NUMBER
0	3. Attach maile	B. REPORT TITLE AND/OR NUMBER Airport Movement Area Safetey System (AMASS) 3. Attach: ************************************
84	on reve 2. Comple	A. ORIGINATING AGENCY DOT/FAA Hughes Tech- Center, Atlantic City Int'l Airport, NJ
	REQUE	1. REPORT IDENT:FYING INFORMATION
DTIC ACCESSION NOTICE	DTIC	AD NUMBER DATE 5/9/01

DTIC Form 50

			lechnical Report D	ocumentation Pag		
1. Report No.	2. Government Access	ion No. 3. F	Recipient's Catalog No.			
DOT/FAA/CT-TN00/27						
4. Title and Subtitle	1	5. P	Report Date			
Airport Movement Area Safet	y System (AMASS)		December 2000	1		
Operational Test, Final Rep			erforming Organizatio	n Code		
			7 CIT 210			
ļ			ACT-310	- D N-		
7. Author(s)			erforming Organization	•		
Dan Dellmye	r	100.1	C/FAA/CT-TN00/	21		
Performing Organization Name and Addre		10	Work Unit No. (TRAIS	\		
U.S. Department of Transpor		10.	77 OIN OIM 140: (11 12-110	,		
Federal Aviation Administra		11.	Contract or Grant No.			
William J. Hughes Technical	Center					
Atlantic City International	Airport, NJ 08	405 13.	Type of Report and Pe	eriod Covered		
12. Sponsoring Agency Name and Address						
U.S. Department of Transpor			Technical Not	.e		
Federal Aviation Administra	tion					
William J. Hughes Technical			Sponsoring Agency Co	ode		
Atlantic City International	Airport, NJ 08	405				
15. Supplementary Notes						
16. Abstract						
This final report documents	the tests resul	lts on the Airpor	t Movement			
				d at		
Area Safety System (AMASS) Air Traffic (AT) Operational Testing conducted at Atlanta, GA and Detroit, MI International Airports. The purpose of the AMASS Operational Test (OT) was to verify the Critical Operational Issues (COI).  The AMASS is a runway collision alert system that provides tower air traffic controllers with automated conflict warnings and alerts to reduce the risks of runway collisions. The AMASS system provides tower controllers with both aural and visual alerts.						
	•	•				
traffic controllers with automated conflict warnings and alert reduce the risks of runway collisions. The AMASS system provi						
The AMASS is a runway collision alert system that provides tower air traffic controllers with automated conflict warnings and alerts to reduce the risks of runway collisions. The AMASS system provides tower						
traffic controllers with automated conflict warnings and alerts to reduce the risks of runway collisions. The AMASS system provides						
(ASDE-3) and airborne appro	aw video irom ti	ne Airport Suriac	e Detection E	quipment-3		
			ance Communications			
			data from the Automated data and sends appropriate			
position, vector, and a pre						
are then processed by the A						
targets have the potential						
The Operational Testing on	the AMASS COIs	questions has bee	n evaluated/a	ssessed,		
resulting in no high issues				members felt		
that the AMASS system has s	hown dramatic in	mprovements and i	s currently			
operationally ready.						
		La Billia a Gi				
17. Key Words	G	18. Distribution Statemen		111 t		
Airport Movement Area Safet	y system	Document is on i				
(AMASS)		Hughes Technical City Internation				
Terminal Automation Interfa	ce Unit (TATIL)	CICY INCELHACION	idi Alipoic, f	ND 00403		
Terminal Advonacion interia	oc onic (INIO)					
19. Security Classif. (of this report)	20. Security Classif.	(of this page)	21. No. of Pages	22. Price		
Unclassified	Unclassified	v = i <b>∂</b> /	168			

## TABLE OF CONTENTS

EXE	ECUTIVE SUMMARY	v
1.	INTRODUCTION	1
	1.1 Purpose 1.2 Scope	1
2.	REFERENCE DOCUMENTS	2
3.	AMASS SYSTEM DESCRIPTION	2
	<ul><li>3.1 Mission Review</li><li>3.2 AMASS System Description</li><li>3.3 Test System Configuration</li><li>3.4 Interfaces</li></ul>	2 2 3 3
4.	TEST AND EVALUATION DESCRIPTION	4
	<ul> <li>4.1 AT OT, DT Data Review</li> <li>4.2 AT OT, AMASS Parameter Testing</li> <li>4.3 Operational Testing at ATL</li> <li>4.4 AF OT, DT Data Review</li> <li>4.5 Maintenance Activities Test</li> </ul>	4 5 7 9
5.	ISSUE ASSESSMENT	11
6.	COI RESULTS	11
7.	CONCLUSIONS	13
8.	RECOMMENDATIONS	14
9.	ACRONYMS	15

#### **APPENDICES**

Appendix A AT OT, MOP/MAOR Result Matrix Appendix B AT OT Issue Matrix Appendix C AT OT, APS Sub-Test MOP/MOAR Result Matrix Appendix D AT OT, AMASS Parameter Listing Appendix E AT OT, OET Sub-Test Questionnaires (July 1999) Appendix F AT OT, OET MOP/MAOR Result Matrix Appendix G AT OT, OUT Sub-Test Questionnaires (July 1999) Appendix H AT OT, OUT MOP/MOAR Result Matrix AT OT, OET Sub-Test Questionnaires at ATL (July 1999) Appendix I AT OT, OUT Sub-Test Questionnaires at ATL (July 1999) Appendix J AT Regression Questionnaire Test Responses (June 2000) Appendix K Appendix L AF OT, MOP/MOAR Result Matrix AF OT, AF Questionnaires (February 1999) Appendix M Appendix N AF OT Issue Result Matrix Appendix O AF OT, AF Regression Comments (June 2000)

#### **EXECUTIVE SUMMARY**

The Operational Test (OT) for the Airport Area Movement Safety System (AMASS) was split into two testing phases, Airway Facilities (AF) OT and Air Traffic (AT) OT. The AF OT testing was conducted at Detroit Metropolitan Wayne Airport (DTW) on April 20 through 29, 1999. The AT OT testing was conducted at William B. Hartsfield Atlanta Airport (ATL) on July 18 through August 20, 1999. Any open issues that resulted from the AF and AT OT testing were verified during AF and AT regression testing. The AF OT regression testing was conducted at DTW and was held on February 22 and 23, 2000. The AT OT regression testing was conducted at ATL on June 1 through 23, 2000.

The Operational Testing on the AMASS Critical Operational Issues (COI) questions have been evaluated/assessed, resulting in no high issues. The following medium issues are associated with COI listed below:

COI 1: Does the AMASS provide the controller with alerts on potential runway collisions?

AT Issue 8: (Medium) AMASS is currently limited to 12,000 feet of movement area coverage from the antenna.

Resolution: Modify AMASS to support the full Airport Surface Detection Equipment-3 (ASDE-3) range coverage of up to 24,000 feet (System Trouble Report (STR) has been written).

Status: This problem will be fixed prior to Dallas Fort Worth International Airport (DFW) and Denver International Airport (DEN) going Operational Readiness Declaration.

COI 2: Is the AMASS site adaptable (e.g., eliminate unwanted alerts due to: multipath, sequential alerts, etc.)?

By implementing key software fixes the false alert rate was reduced from over 60 per month to approximately 4 per month. The nuisance alert rate that coincided with the AMASS final parameter set was approximately two per month.

AF Issue 2: (Medium) Line Replacement Unit (LRU) replacement from the front of the cabinet for the Central Processing Unit (CPU) is very difficult. Cable dressing complicated the removal/replacement procedures, with cable ties having to be cut to facilitate removal of equipment.

*Resolution:* Modify AMASS equipment to support LRU replacement from the front of the cabinet.

Status: STR has been written.

COI 3: Does the AMASS provide the controls and displays necessary for the controller/supervisor to perform the assigned duties?

AT Issue 6a: (Medium) AT Training should include a clear and concise presentation on the AMASS Alert Scenarios.

Resolution: Provide a video demonstrating each AMASS alert scenario on the potential collisions.

Status: Currently the training does provide slides on each alert scenario, but the OT test team members want to see a video demonstration on each AMASS alert scenario (Visual Aid on the general timing and distance of each alert scenario).

AT Issue 7b: (Medium) The AT Users Manual provides too much information for use by a controller on a day-to-day basis.

Resolution: Include a Quick Reference Card to summarize the AMASS commands (in addition to the planned Mini-Display Control Unit (DCU) keypad template.)

Status: AMASS Work Group has this issue and is in the process of deciding whether or not to develop a quick reference card.

COI 4: Does the AMASS provide the controller the capability to inhibit/re-inhibit specific targets from activating alerts?

No concerns/issues were expressed with the inhibit/re-inhibit functionality.

COI 5: Does the AMASS degrade any other FAA system to which it is interfaced?

AF Issue 10: (Medium) AMASS is generating a video stitching on the ASDE-3 Display.

Resolution: Modify the AMASS equipment to resolve the video timing issue.

Status: A screen refresh removes the video stitching; this problem will be fixed (STR has been written).

The AF/AT OT Test Team members felt that the AMASS system has shown dramatic improvements and is currently operationally ready.

#### 1. INTRODUCTION.

#### 1.1 PURPOSE.

The purpose of Airport Movement Area Safety System (AMASS) Operational Testing was to verify that the AMASS satisfies the five following Critical Operational Issues (COI) defined in the AMASS Operational Requirements Document (ORD):

- **COI-1:** Does the AMASS provide the controller with alerts on potential runway collisions?
- COI-2: Is the AMASS site adaptable (e.g., eliminate unwanted alerts due to: multipath, sequential alerts, etc.)?
- COI-3: Does the AMASS provide the controls and displays necessary for the controller/supervisor to perform the assigned duties?
- COI-4: Does the AMASS provide the controller the capability to inhibit/re-inhibit specific targets from activating alerts?
- **COI-5:** Does the AMASS degrade any other Federal Aviation Administration (FAA) system to which it is interfaced?

To accomplish the above task, the AMASS Operational Test (OT) Plan allocated each individual AMASS ORD requirement to one or more of the five COIs as Measures of Performance (MOP). A success criteria, or Minimum Acceptable Operating Requirement (MAOR), was then derived from each MOP. The AMASS Operational Test Plan then allocated each MOP/MAOR pair to either the Airways Facilities (AF) OT effort or the Air Traffic (AT) OT effort. Each MOP/MAOR pair allocated to the AT/AF OT effort was then further allocated to one or more of the three planned AT/AF OT test procedures.

#### 1.2 SCOPE.

This report discusses the results of the AMASS OT testing; the OT testing was split into two testing phases, an AF and AT. The AF OT testing was conducted at Detroit Metropolitan Wayne Airport (DTW) on April 20 through 29, 1999. The AT OT testing was conduct at William B. Hartsfield Atlanta Airport (ATL) on July 18 through August 20, 1999. The open issues that resulted from the AF and AT OT testing were verified during an AF and AT regression testing. The AF OT regression testing was conducted at DTW and was held on February 22 and 23, 2000. The AT OT regression testing was conducted at ATL on June 1 through 23, 2000.

#### 2. REFERENCE DOCUMENTS.

The following documents are referred in this test report or provide useful information:

- a. AMASS Operational Test Plan, dated March 1999
- b. AMASS AF OT Test Procedures, dated March 1999
- c. AF OT Quick Look Report, dated April 1999
- d. AF OT Regression Quick Look Report, dated February 16, 2000, Report Number: DOT/FAA/CT/ACT300-00-02
- e. AMASS OT AT Test Procedures, dated May 1999
- f. AT OT Quick Look Report, dated June 1999
- g. AMASS OT AT Regression Test Plan/Procedures, dated June 12, 2000
- h. AT OT Regression Quick Look Report, dated June 23, 2000, Report Number: DOT/FAA/CT/ACT300-00-01

#### 3. AMASS SYSTEM DESCRIPTION.

#### 3.1 MISSION REVIEW.

The AMASS is a runway collision alert system that provides tower air traffic controllers with automated conflict warnings and alerts to reduce the risks of runway collisions. The AMASS system provides tower controllers with both aural and visual alerts.

#### 3.2 AMASS SYSTEM DESCRIPTION.

The AMASS system receives raw video from the Airport Surface Detection Equipment-3 (ASDE-3) and airborne approach targets from the Terminal Automation Interface Unit (TAIU). The TAIU receives target data from the Surveillance Communications Interface Processor (SCIP) and aircraft tag data from the Automated Radar Tracking System (ARTS). It tracks this data and sends appropriate position, vector, and a predicted approach runway to AMASS. Targets are then processed by the AMASS Safety Logic to determine if any targets have the potential to create a hazardous situation. When it is determined there is a possible hazardous situation, AMASS will deliver an aural alert, a visual text message, and highlight the targets in potential conflict.

#### 3.3 TEST SYSTEM CONFIGURATION.

#### **AT Operational Testing**

The AMASS was tested with full functionality except for the Pre-Product Improvements. The AMASS system relies on the ASDE-3/TAIU configuration, local airport operations, and external equipment interfaces. All the AMASS alerts were tested in the factory, but only a subset was optimized for the various sites. The test was conducted using the AMASS software Build 2.0 and included local site adaptation parameters at ATL. The TAIU software was Build 2.0 and ASDE-3 software Build 611.3.

The airport configuration at ATL consisted of four parallel runways. The ASDE-3 antenna is located on top of the tower cab. The ASDE-3/AMASS is configured as a seven-channel system. The ATL Terminal Radar Approach Control Facility (TRACON) is co-located at the airport and also the ARTS IIIA. Terminal Surveillance data is provided by ASR-9 located at the airport. The AMASS TAIU is located at the TRACON.

#### **AF Operational Testing**

The AMASS was tested with full maintenance functionality. The AMASS system relies on the ASDE-3 RMS interface. The test was conducted using the AMASS software Build 1.0 and included local site adaptation parameters at DTW. The TAIU software was Build 1.0 and ASDE-3 software Build 611.3.

The DTW ASDE-3 antenna is located on top of the tower cab. The ASDE-3/AMASS is configured as a five-channel system. The DTW TRACON is co-located at the airport and also the ARTS IIIA. Terminal Surveillance data is provided by ASR-9 located at the airport. The AMASS TAIU is located at the TRACON.

#### 3.4 INTERFACES.

The AMASS external interfaces consist of the ASDE-3, and the TAIU. The TAIU interfaces with the SCIP, and the ARTS IIIA.

The ASDE-3 provides radar target data on objects up to the tower height, and 24,000 feet horizontal. The ASDE-3 also provides the display/control functions, and the RMS interface to the AMASS via serial lines. For airborne-approach aircraft, surveillance radar data is received from the SCIP via the AMASS TAIU and transmitted to the AMASS cabinet by serial modems. The TAIU also interfaces with the ARTS IIIA to receive flight plan information.

Only the ARTS IIIA, ARTS IIIE, and ARTS IIE interfaces are currently developed. The remaining automation interfaces such as Enroute Automated Radar Tracking System (µEARTS), and Standard Terminal Automation Replacement System (STARS) have yet to be developed for the TAIU. These preplanned interface improvements, along with flight plan functionality, including the use of aircraft tag data, were not evaluated during this Operational Testing.

#### 4. TEST AND EVALUATION DESCRIPTION.

The OT testing was split into two testing phases; AF and AT. The AT OT testing was broken down into three testing events; Developmental Test (DT) Data Review, AMASS Parameter Test, and the Normal Operations Test. The AF OT testing was broken down into two testing events; DT Data Review, and the System Maintenance Activities Test. The following sections discuss the test events/results of the AMASS AT/AF OT testing.

#### 4.1 AT OT, DT DATA REVIEW.

#### 4.1.1 Test Event Description.

The AT DT Data Review was performed at the Technical Center. The DT Data Review consisted of a desk audit of the contractor performed Development Test and Site Acceptance Test reports, System Trouble Reports (STR), the AMASS ORD and the AMASS Specification (FAA-E-2869), the AMASS AT training course, document reviews and formal contractual approvals. This review evaluated whether each of the MOPs, identified in the DT procedure, had been satisfactorily tested and whether the results met the corresponding success criteria (MAORs).

#### 4.1.2 Results/Discussion.

All the MOPs/MAORs passed except for MOP/MOAR 1-26 listed below. Appendix A to this report includes the MOP/MAOR Result Matrix.

### MOP-1.26:

Clutter Map. AMASS shall maintain a clutter map to aid in the removal of static or slowly varying clutter.

#### MAOR-1.26:

An AMAS clutter map must be maintained to aid in the removal of static or slowly varying clutter.

MOP/MOAR 1-26 is failed because AMASS Clutter Map is limited to 12,000 feet of movement area coverage where the ASDE-3 area coverage is 24,000 feet. Norden will modify the AMASS system to support the full ASDE-3 range coverage (STR has been written). This issue (AT Issue #8, appendix B) was classified as a Medium and will be fixed prior to Dallas Fort Worth Airport (DFW) and Denver International Airport (DEN) going Operational Readiness Declaration.

Appendix B to this report includes the AT Issue Matrix.

#### 4.2 AT OT, AMASS PARAMETER TESTING.

The purpose of the AMASS Parameters Testing was to determine if the AMASS could be adapted to allow for the implementation of the alert set and parameterization concept desired by the AMASS Working Group (AWG). This test event was divided into three sub-tests; the AMASS Parameter Study (APS), the Operational Events Test (OET) and the Operational Usage Test (OUT). These test events were conducted at the Technical Center using the ACT-310 AMASS laboratory facilities.

### 4.2.1 AMASS Parameter Study (APS).

#### 4.2.1.1 Test Event Description.

The purpose of the APS sub-test was to determine if the AMASS is sufficiently adaptable to minimize false and nuisance alerts and to develop an initial alert set based on parameterization concept provided by the AMASS Working Group.

#### 4.2.1.2 Data Collection/Analysis.

The process began with the collection of AMASS data at San Francisco International Airport (SFO), ATL, and DTW. More than 1000 hours of AMASS data was recorded in SFO and ATL, and was sent to the Technical Center for analysis. Additionally, approximately 500 hours of usable data were collected in DTW. Data were collected for AMASS using both the STANDBY and ONLINE ASDE-3 transmitters. In addition, both encoder A and B were exercised during data collection.

The analysis consisted of replaying the recorded data utilizing the playback feature of the AMASS. This feature allows for data to be played using different alert sets, time/distance alert parameters, airport configurations, and multipath parameters. The initial analysis of the data received from Atlanta began with an alert and parameter set that was conservative. Alert listings were generated and analyzed to determine the number of false alerts (primarily due to false targets) and real alerts. Once this analysis was completed, the AMASS parameters were modified in an attempt to reduce the number of nuisance alerts that did not meet the guidelines set forth in the AMASS Working Group. This process was repeated through four subsequently tighter alert sets until the parameterization of the AMASS alert set was optimized to minimize nuisance alerts.

#### 4.2.1.3 Results/Discussion.

All the MOPs/MOARs (appendix C) in this sub-test passed with no open issues.

The init adaptation test had six STRs written to lower the false alert rate. The main issues found during this test are:

- a. (Issue #1e, appendix B) False tracks can reach real track status on a taxiway and then move across the grass and onto runway surfaces resulting in false alerts.
- b. (Issue #1d, appendix B) AMASS generates false tracks and false alerts in heavy rain.
- c. (Issue #1a, appendix B) Long-term false tracks on a runway surface will transition to "real" track status within 4 minutes.

These issues listed above were verified/passed during the AT OT regression-testing period. The false alert rate was reduced from over 60 per month to approximately 4 per month. The nuisance alert rate that coincided with the final parameter set was approximately two per month. The final alert parameter study was presented to the AMASS Work Group on June 23, 2000, at the OT Regression testing phase, and the final parameter listing is contained in appendix D.

### 4.2.2 Operational Events Test (OET).

#### 4.2.2.1 Test Event Description.

The purpose of the OET sub-test was to demonstrate the AMASS response to each alert situation included in the core alert set. The OET sub-test utilized the data collected and analyzed during the APS sub-test to develop specific scenarios for each alert cell that was identified in the AWG alert set. Twenty-eight test cases, comprised of one or more iterations, were developed.

#### 4.2.2.2 Data Collection/Analysis.

AT controllers were asked to view each alert scenario and record how the AMASS response to the situation presented would affect their ability to perform their assigned duties when following the Draft ATC AMASS Operational Procedures. The test team responses were then transcribed and reviewed (appendix E). Test team discussions were held to review the composite results. The feedback received on the questionnaires and in the discussion sessions were then used to determine if any further modifications to the initial parameterization concept were necessary prior to the conclusion of the test and in preparation for OT at ATL.

#### 4.2.2.3 Results/Discussion.

The execution of the OET sub-test resulted in minor modifications to the time/distance parameterization of AMASS. All the MOPs/MOARs (appendix F) in this sub-test have passed with no open issues.

One of the main issues found during this test relates to taxiing aircraft across/off the runway surfaces, which sometimes can cause alerts because these tracks do not include a projection vector. The AMASS system was modified to use a projection vector which reduced the number of nuisance alerts. These issues were verified and closed at the OT regression-testing period.

#### 4.2.3 Operational Usage Test (OUT) Sub-Test.

#### 4.2.3.1 Test Event Description.

The purpose of the Operational Usage Test (OUT) was to examine the AT training, documentation, and usage of the AMASS User Interface.

#### 4.2.3.2 Data Collection/Analysis.

The OUT sub-test was performed after the initial AT OT training introduction was given and after the test team members had an opportunity to use the AMASS user interface. A questionnaire (appendix G) was given to each test team and a discussion session was held to review the answers and any issues.

#### 4.2.3.3 Results/Discussion.

All the MOPs/MOARs (appendix H) in this sub-test were passed during the AT OT regression-testing period.

Several issues were generated during this testing phase. The two issues that remain open are the following:

- a. (Issue #6b, Medium, appendix B) AT Training should include a clear and concise presentation (video demonstration) on the AMASS Alerts.
- b. (Issue #7b, Medium, appendix B), the test team members felt that the AT User's Manual was too cumbersome for day-to-day use and that a Quick Reference Card should be included in the manual.

#### 4.3 OPERATIONAL TESTING AT ATL.

The purpose of performing operational testing at the ATL was to expose the test team members to AMASS operations in an operational setting. The operational testing was divided into two sub-tests; the OET and OUT.

#### 4.3.1 Operational Events Test (OET) Sub-Test.

#### 4.3.1.1 Test Event Description.

The OET sub-test consisted of injecting synthetic targets against Targets of Opportunity to create each alert scenario script. The OT Test Team members would evaluate each alert scenario script in the Tower Cab.

#### 4.3.1.2 Data Collection/Analysis.

The test team was asked to view each alert scenario and record how the AMASS response to the situation presented would affect their ability to perform their assigned duties when following the Draft ATC AMASS Operational Procedures. The feedback received on the questionnaires (appendix I) and in the discussion sessions were then used to determine if any further modifications to the AMASS parameters were necessary prior to the conclusion of the test.

#### 4.3.1.3 Results/Discussion.

The execution of the OET sub-test resulted in minor modifications to the time/distance parameterization of AMASS. All open issues in this sub-test have passed and was verified during the AT OT regression-testing period.

One of the issues during this test was the TAIU might not provide the first update for a new target under track until up to 4 seconds after entering the runway approach zone. The TAIU was fixed to provide the first update within 1 second after entering the runway approach zone. This issue was verified and retested at the AT OT regression-testing period.

#### 4.3.2 Operational Usage Test (OUT) Sub-Test.

#### 4.3.2.1 Test Event Description.

The purpose of this OUT sub-test was to examine the training, documentation, and usage of the AMASS User Interface in an operational setting.

#### 4.3.2.2 Data Collection/Analysis.

Test team members were given the opportunity to use the AT User's Manual and AMASS User Interface to perform the three AMASS operations prior to completing the questionnaires (appendices J and K) which included selecting operational configurations, opening/closing runways, and adjusting the alert speaker volume. The AT Test Team members had formal AMASS AT training prior to going to ATL.

#### 4.3.2.3 Results/Discussion.

All open issues in this sub-test passed and were verified during the AT OT regression-testing period except for issues 6b and 7b (refer to section 4.2.3.3).

#### 4.4 AF OT, DT DATA REVIEW.

#### 4.4.1 Test Event Description.

The AF DT Data Review was performed at the Technical Center. The DT Data Review consisted of a desk audit of the contractor-performed Development Test and Site Acceptance Test reports, STRs, the AMASS ORD and the AMASS Specification (FAA-E-2869), the AMASS AT training course, document reviews, and formal contractual approvals. This review evaluated whether each of the MOPs identified in the DT procedure had been satisfactorily tested and whether the results met the corresponding success criteria (MAORs).

#### 4.4.2 Results/Discussion.

All the MOPs/MAORs have passed. Appendix L to this report includes the MOP/MAOR Result Matrix.

#### 4.5 MAINTENANCE ACTIVITIES TEST.

#### 4.5.1 Test Event Description.

The AMASS AF Operational Testing took place April 20 through 29, 1999, at DTW. This test was concerned with determining whether the AMASS (including contractor provided training and documentation) is effective and suitable for inclusion into the National Airspace System (NAS) from a maintenance perspective. The evaluation approach used was to perform a series of test procedures with test teams comprised of representative users from AF field organizations. Three AF technicians were in attendance representing Central, Great Lakes, and Southern regions. The test team members were presented with a series of test procedures, each having a defined objective. After each test procedure was performed, the test team members filled out a series of questionnaires.

Three types of testing were conducted at the DTW. These were:

- a. System Corrective Actions Test
- b. System Maintenance Activities Test
- c. NAS Integration and Degraded Operations Test

The AF System Corrective Actions Test verified that AF Technicians have the tools, training, and documentation necessary to maintain the AMASS to the Line Replacement Unit (LRU) level. This test was performed using AF Technicians to detect, isolate, and correct faults inserted into the system by the test engineers. Opinions were collected from the AF Technicians as to the correctness and completeness of the provided materials to accomplish the assigned tasks at the end of each test script.

The System Maintenance Activities Test verified that the AF Technicians have the tools, training, and documentation necessary to ensure the AMASS system is operating correctly on a day-to-day basis. This includes the documentation, procedures, and test equipment necessary to certify the system for use on a day-to-day basis. It also includes a verification of the logistics support system in place to support the AMASS system throughout its life cycle. This includes logistical support as it relates to the LRU, consumables, software maintenance, site adaptation and optimization, and other logistical support activities included in the AMASS Maintenance concept. This test used AF Technicians to perform the specified maintenance activities included in the Maintenance Handbook. They were asked to provide feedback on the acceptability of the provided training, equipment, and related materials.

The AMASS NAS Integration and Degraded Operations Test verified, from an AF perspective, that the requirements associated with the three interfaces to the systems are already established in the NAS system. These interfaces are: the AMASS/TAIU, the AMASS/ASDE-3 display subsystem, and the AMASS/ASDE-3 Remote Maintenance Monitoring (RMS) Subsystem. The test also verified the ability of the AMASS to continue to perform the assigned mission when the AMASS system is not operating at 100 percent. This testing took place from two perspectives. First, it focused on the ability of the AMASS to continue operating when one of its subsystem has failed. Failures included both AMASS implemented interface failures and core LRU failures. Secondly, the ability of the AMASS to continue to perform its mission when the ASDE-3 is operating in various degraded states. (This section was verified using Maintenance Demo held at Norden.)

Dimensions International, developers of the TAIU, provided the TAIU operation and familiarization training as well as the preventive maintenance procedure overview. The training was extremely useful, as none of the technicians were familiar with the TAIU system before arrival. The technicians cited the TAIU users and troubleshooting manuals, as being acceptable, although clarification is required in many areas. Many of the concerns arose over the areas of logistic and second level support. Detailed training at each site, as proposed, will remedy these concerns. Appendix M to this report includes the composite AF questionnaires (February 1999).

#### 4.5.2 Results/Discussion.

In April 1999, the major issue was that the AMASS manuals were inadequate in performing LRU replacement and general maintenance procedures on the AMASS system. AOS discussed system certification issues with the test participants at length, and began development of certification procedures.

All open issues except for issue #2 and #10 were verified and passed during the regression testing at DTW the week of June 18, 2000. The AF technicians performed certification procedures and reviewed the change pages to the Maintenance manual. The AMASS manuals were improved but additional comments were generated by the AF technicians and were incorporated. The technicians followed the certification procedures step-by-step. There are some

discrepancies that need to be corrected, but the technicians feel they can certify the AMASS and TAIU.

Issue #2 remains open because the LRU replacement from the front of the cabinet for the Central Processor Unit (CPU) is very difficult. Cable dressing complicated the removal/replacement procedures, with cable ties having to be cut to facilitate removal of equipment. This issue (appendix N) was classified as a Medium. Issue #10 is open because AMASS is generating a video stitching on the ASDE-3 Display. This issue was classified as a medium because the video stitching occurs only on a few displays and can take hours and even days to become visible; also any type of screen refresh on the display removes the video stitching.

Appendix N to this report includes the AF Issue Matrix.

Appendix O to this report includes the AF Regression Test comments to the AMASS manuals.

#### 5. ISSUE ASSESSMENT.

The OT test team analyzed the correlated test data to determine if operational issues existed and if so, assessed the operational impact. Each issue was identified a criticality which has been defined as follows:

- a. High A problem that will prevent, degrade, or interrupt operational service or jeopardize safety, and has no acceptable work-around.
- b. Medium To prevent, degrade, or interrupt operational service or jeopardize safety, but has an acceptable work-around.
- c. Low The issue constitutes an improvement to the operational use of AMASS and can be resolved through post-commissioning modifications.

#### 6. COI RESULTS.

The evaluation results specific to each COI are presented in the following subsections and categorized by the MOP/MAOR. All the MOPs/MAORs are listed in appendices A and L.

#### 6.1 COI 1:

Does the AMASS provide the controller with alerts on potential runway collisions?

#### 6.1.1 COI 1 Results.

The following issue is associated with this COI:

AT Issue 8: (Medium) AMASS is currently limited to 12,000 feet of movement area coverage from the antenna.

Resolution: Modify AMASS to support the full ASDE-3 range coverage of up to 24,000 feet (STR has been written).

Status: This problem will be fixed prior to DFW and DEN going Operational Readiness Declaration.

#### 6.2 COI 2:

Is the AMASS site adaptable (e.g., eliminate unwanted alerts due to: multipath, sequential alerts, etc.)?

#### 6.2.1 COI 2 Results.

The following issues are associated with this COI:

AF Issue 2: (Medium) LRU replacement from the front of the cabinet for the CPU is very difficult. Cable dressing complicated the removal/replacement procedures, with cable ties having to be cut to facilitate removal of equipment.

Resolution: Modify AMASS equipment to support LRU replacement from the front of the cabinet.

Status: STR has been written.

#### 6.3 COI 3:

Does the AMASS provide the controls and displays necessary for the controller/supervisor to perform the assigned duties?

#### 6.3.1 COI 3 Results.

The following issues are associated with this COI:

AT Issue 6a: (Medium) AT Training should include a clear and concise presentation on the AMASS Alert Scenarios.

Resolution: Provide a video demonstrating each AMASS alert scenario on the potential collisions.

Status: Currently the training does provide slides on each alert scenario, but the OT test team members want to see a video demonstration on each AMASS alert scenario (Visual Aid on the general timing and distance of each alert scenario).

AT Issue 7b: (Medium) The AT Users Manual provides too much information for use by a controller on a day-to-day basis.

Resolution: Include a Quick Reference Card to summarize the AMASS commands (in addition to the planned Mini-Display Control Unit (DCU) keypad template.)

Status: AMASS Work Group has this issue and is in the process of deciding whether or not to develop a quick reference card.

#### 6.4 COI 4:

Does the AMASS provide the controller the capability to inhibit/re-inhibit specific targets from activating alerts?

#### 6.4.1 COI 4 Results.

No concerns/issues were expressed with the inhibit/re-inhibit functionality.

#### 6.5 COI 5:

Does the AMASS degrade any other FAA system to which it is interfaced?

#### 6.5.1 COI 5 Results.

The following issues are associated with this COI:

AF Issue 10: (Medium) AMASS is generating a video stitching on the ASDE-3 Display. Resolution: Modify the AMASS equipment to resolve the video timing issue.

Status: A screen refresh removes the video stitching; this problem will be fixed (STR has been written).

#### 7. CONCLUSIONS.

The Air Traffic (AT) regression testing closed 30 out of 37 issues with no high issues. The remaining seven open issues contain only three medium and four low priority issues. The medium issues are in section 6. with a current status. The Low issues have been passed onto

Airway Operational Support (AOS) for future improvements to the Airport Movement Area Safety System (AMASS).

The Airway Facilities (AF) regression testing closed 17 out of 19 issues with no high issues. The remaining two open issues are classified as medium. The medium issues are in section 6. with a current status.

The Operational Testing on the AMASS Critical Operational Issues (COI) questions have been evaluated/assessed, resulting in no high issues. The AF/AT Operational Test Team members felt that the AMASS system has shown dramatic improvements and is currently operationally ready.

### 8. RECOMMENDATIONS.

Implement a System burn in period (~30 days) at each site to verify system adaptation/optimization and to verify system performance such as false/nuisance alert rate in each new environment.

#### 9. ACRONYMS.

AMASS Airport Area Movement Safety System

AF Airway Facilities

AOS Airway Operational Support APS AMASS Parameter Study

ARTS Automated Radar Tracking System
ASDE-3 Airport Surface Detection Equipment-3

AT Air Traffic

ATL William B. Hartsfield Atlanta Airport

AWG AMASS Working Group
COI Critical Operational Issues
DCU Display Control Unit

DEN Denver International Airport

DFW Dallas Fort Worth International Airport

DT Developmental Test

DTW Detroit Metropolitan Wayne Airport FAA Federal Aviation Administration

LRU Line Replacement Unit

MAOR Minimum Acceptable Operating Requirement

MOP Measures of Performance NAS National Airspace System OET Operational Events Test

ORD Operational Requirements Document

OT Operational Test

OUT Operational Usage Test

RMS Remote Maintenance Monitoring

SCIP Surveillance Communications Interface Processor

SFO San Francisco International Airport

STARS Standard Terminal Automation Replacement System

STR System Trouble Report

TAIU Terminal Automation Interface Unit

TRACON Terminal Radar Approach Control Facility

µEARTS Enroute Automated Radar Tracking System

# APPENDIX A AT OT, MOP/MAOR Result Matrix

TEST DATA LOG.

TEST DATE(S): 7/19/99 THROUGH 7/30/99

Test Coordinator: Chuck Dudas

Test Engineer: Jeff Livings

PRIORITY			
PR			
PROPOSED SOLUTION			
ISSUE			
PASS/ FAIL	PASS		PASS
MAOR	MAOR-1.1: Each of the 26 alerts listed in MOP-1.1 are included in the design of the AMASS.		MAOR-1.2: Alerts not listed in MOP-1.1 but included in the design of AMASS must satisfy MAOR-1.3 through MAOR-1.??.
MOP	MOP-1.1: (from TEMP MOP 3.6) The following list of 26 alerts are included in the design of the AMASS:	1. Opposite direction on taxiway. 2. Opposite direction taxi on runway. 3. Opposite direction departure on runway. 4. Stopped target on runway. 5. Opposite direction landing on runway. 6. Opposite direction departure on taxiway. 7. Departure with stopped target 8. Landing and arrival with stopped target. 9. Departure chasing a departure. 10. Departure chasing a landing. 11. Departure chasing a landing. 12. Landing chasing a landing. 13. Landing chasing a landing. 14. Landing chasing a taxi. 15. Departure head-on departure. 16. Departure head-on landing. 17. Departure head-on landing. 18. Landing head-on landing. 20. Landing head-on landing. 21. Arrival chasing a departure. 22. Arrival chasing a taxi. 23. Arrival chasing a landing. 24. Arrival head-on landing. 25. Arrival head-on landing. 26. Arrival head-on landing.	MOP-1.2: Source: Derived from COI-1 Types of alerts not listed in MOP-1a, but included in the design of AMASS must meet the same requirements.

PASS/ FAIL ISSUE PROPOSED SOLUTION PRIORITY	Alerts 1 through 6 of PASS ould generate audible autions.	Alerts 6 through 26 of PASS ould generate audible varnings.		One voice warning is PASS r Alerts 7 through 26 of		The current warning PASS ust be displayed.		Target extent data PASS s performed by AMASS.	
				MAOR-1.5: One voice warning is PASS generated for Alerts 7 through 26 of MOP 1.1.				MAOR-1.6: Target extent data PASS processing is performed by AMASS.	
MAOR	MOP-1.3:  Source: ORD 3.f.(1).(a).S1  an  All single track clears shall he	MOP-1.4: M Source: ORD 3.f.(1).(a).\$2 an	all paired track alerts shall be "Warnings".	MOP-1.5: M Source: ORD 3.f.(1).(d).51 ge M	Alert message processing shall issue one and only one voice warning alert message per paired tracks.	MOP-1.6: Co Source: ORD 3.f.(1).(d).S3	Displayed text messages shall continue to be updated, thus ensuring that the current warning condition is displayed.	MOP-1.7: Source: ORD 3.j.(1).S1 pr	AMASS shall provide target extent

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-1.8: Source: ORD 3.j.(1).\$2	MAOR-1.8: If any part of an aircraft is past the hold short line, runway alerts are issued.	PASS			
If the nose or tail of a target as determined by the target extent data combined with the direction of travel indicates that the target is "hanging over" onto an intersecting runway or in the area between the "clear of runway" hold short line and the runway, the target shall be considered to be "on the runway".					
MOP-1.9: Source: ORD 3.j.(2) The intersection data in the data base configurations for each intersection shall reflect site-smedifor manway hold	MAOR-1.9: Hold Short Line information is included in the site-specific data.	PASS			
short line information.					
MOP-1.10: Source: ORD 3.1.(1)	MAOR-1.10: Targets on closed runways are tracked.	PASS			
AMASS shall maintain tracks of targets on closed runways, but some alerts shall be inhibited for tracks on closed runways in the following situations:					
MOP-1.11: Source: ORD 3.1.(1).(a)	MAOR-1.11: Single-track caution alerts for tracks on closed runways are not issued except for specific arrivals.	PASS			
Alerts for all single-track caution cells for tracks on closed runways shall be inhibited except for specific arrivals.					

MOP		PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-1.12: Source: ORD 3.1.(1).(b)	MAOR-1.12: Two-track alerts are not generated on closed runways.	PASS			
Two-track conflict alerts shall be inhibited when both tracks are on the same or different closed runways.					
MOP-1.13: Source: ORD 3.1.(2).(a) When a runway is closed, an alert shall be generated for an arrival track approaching that runway.	MAOR-1.13: Landing on a closed runway does generate an alert.	PASS			
MOP-1.14: Source: ORD 3.m.(3).\$3	MAOR-1.14.1: Arrival Indicator lines are not displayed when non-arrival alerts occur.  MAOR-1.14.2: Arrival Indicator lines are displayed when arrival	PASS			
An arrival indicator line shall be displayed only when an alert involving an arrival track occurs.  MOP-1.15:		PASS			
Source: ORD 3.r.(1).\$1  Tracking. The AMASS shall acquire and maintain track on at least 200 valid targets detected by the ASDE-3.					
MOP-1.16: Source: ORD 3.r.(1).52	MAOR-1.16: AMASS Probability of track is greater than 99.9.	PASS			
The probability that any aircraft is correctly in track shall be at least 99.9 percent.					

MOP MOP-1.17:	MAOR MAOR-1.17: Coasted tracks not	PASS/ FAIL PASS	ISSUE	PROPOSED SOLUTION	PRIORITY
Source: ORD 3.r.(1).\$3  A coasted track shall be counted as a	within 20 meters of actual track will reduce Probability of track.				
tracking failure if the distance between the coasted track position and the actual target position exceeds 20 meters.					
MOP-1.18: Source: ORD 3.r.(2).(a).\$1	MAOR-1.18: AMASS data is displayed on ASDE-3 display once per scan without delaying the processing and display of the ASDE-3 data.	PASS			
ASDE-3. The AMASS shall be capable of processing ASDE-3 surveillance data and displaying AMASS data on each ASDE-3 radar display once per scan without delaying the processing and display of the ASDE-3 data.					
MOP-1.19: Source: ORD 3.r.(2).(a).\$2	MAOR-1.19: AMASS accommodates data from either ASDE-3 channel.	PASS			
AMASS shall accommodate target data from either channel of the ASDE-3.					
MOP-1.20: Source: ORD 3.r.(2).(b)	MAOR-1.20: AMASS will process TAIU data within 0.5 seconds of receipt.	PASS			
TAIU. The arrival track position data shall be accepted and processed by AMASS within 0.5 second of receipt.					
MOP-1.21: Source: ORD 3.r.(3).\$1	MAOR-1.21: Arrival-ASDE-3 correct track data correlation must exceed 90%.	PASS			
Arrival-ASDE-3 Track Data Correlation. The probability of correct arrival-ASDE-3 correlation shall exceed 90 percent.					

PROPOSED SOLUTION PRIORITY			AMASS STR-PROD-0001 has been implemented.	AMASS STR-PROD-0006, , 0003, 0005 has been implemented	itten.
PROPOSED			AMASS ST been implen	AMASS STR 0003, 0005 h implemented	STR was written
ISSUE					AMASS Clutter Map is limited to 12,000ft, ASDE-3 coverage area is 24,000 ft.
PASS/ FAIL	PASS	PASS	PASS	PASS	FAIL
MAOR	MAOR-1.22: Arrival-ASDE-3 incorrect track data correlation must be less than 1%	MAOR-1.23: Amival-ASDE-3 missed track data correlation must be less than 10%.	MAOR-1.24; AMASS PoD must be 99% or gretear on a per scan basis for any selected AMASS coverage.	MAOR-1.25: AMASS false detection rate must be less than 10 tracks or 60 per hour.	MAOR-1.26: An AMAS clutter map must be maintained to aid in the removal of static or slowly varying clutter.
MOP	MOP-1.22: Source: ORD 3.r.(3).S2 The probability of false arrival- ASDE-3 correlation (wrong arrival data paired with wrong ASDE-3 track) shall be less than 1 percent.	MOP-1.23: Source: ORD 3.r.(3).S3 The probability of missed arrival-ASDE-3 correlation (arrival data not paired with ASDE-3 track) shall be less than 10 percent.	MOP-1.24: Source: ORD 3.r.(4).\$1  ASDE-3 Target Processing. The AMASS shall detect any aircraft or surface vehicles in any area selected for the AMASS coverage on each opportunity (i.e., for each scan) with a probability of detection of at least 99 percent, including post-detection processing.	MOP-1.25: Source: ORD 3.r.(4).52 The AMASS shall not output false detections at a rate exceeding 10 tracks or 60 detections per hour.	MOP-1.26: Source: ORD 3.r.(5).S1 Clutter Map. AMASS shall maintain a clutter map to aid in the removal of

dOM	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-1.27: Source: ORD 3.r.(5).\$2	MAOR-1.27: AMASS PoD and False detection rates must not be affected fair weather, rain up to 16 mm/hour and snow conditions.	PASS	AMASS generates false tracks and alerts in heavy rain.	A "RAIN" operational configuration that turns of safety logic on ground tracks until rain conditions improve has been created.	
Neither target detection nor false detection rates shall be degraded in weather conditions throughout the AMASS coverage area including fair weather, rain levels up to and including 16 nm/hour; and snow conditions.					
MOP-1.28: Source: ORD 3.r.(8).\$1 Centroiding. The AMASS shall estimate the geometric centroid of each detected target.	MAOR-1.28: AMASS centroiding must estimate the geometric center of each detected target.	PASS			
MOP-1.29: Source: ORD 3.r.(8).\$2	MAOR-1.29: Scan-to-scan fluctuation of the AMASS centroids must not exceed 5 meters.	PASS			
The root-sum-square scan-to-scan fluctuation of the centroid shall not exceed 5 meters north and east combined.					
MOP-1.30: Source: ORD 3.r.(8).\$3	MAOR-1.30: The bias error of the AMASS centoid must not exceed 15 meters.	PASS			
The bias error of the estimated centroid from the true physical centroid shall not exceed 15 meters.		·			
MOP-2.1: Source: ORD 3.a.(1).\$1	MAOR-2.1: AMASS includes a capability to establish and maintain site-specific data bases to any airport.	PASS			
The AMASS shall provide the capability to establish and maintain all of the site-specific functional and system data bases to adapt the operations of AMASS at any airport.					

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-2.2: Source: ORD 3.a.(1).\$2	MAOR-2.2: Each operational runway must have a unique AMASS data base configuration.	PASS			
A unique AMASS data base configuration shall be created and available for use for each of the operational runway configurations that are employed at the adapted airport.					
MOP-2.3: Source: ORD 3.a.(1).\$3	MAOR-2,3: The AMASS adaptation capability must include the ability to define one and two-way traffic flows on runways and taxiways.	P31	This feature is not included in the AMASS design	Reconsider the need for the feature. (AMASS Work Group is working this issue for P31)	
The adaptation capability shall include defining traffic flows that may include one-way traffic flows on runways and taxiways.					
MOP-2.4: Source: ORD 3.a.(1).54	MAOR-2.4: The AMASS adaptation capability must include the runway incursion safety logic parameters.	PASS			
It shall also include the specific runway incursion safety logic parameters.					
MOP-2.5: Source: ORD 3.a.(2).\$1	MAOR-2.5: The AMASS adaptation capability must accept user input to establish and change data items and sets.	PASS			
AMASS shall include a capability to accept user input to establish or change adaptation data items or sets.					
MOP-2.6: Source: ORD 3.a.(2).52 This capability shall be available at each AMASS site.	MAOR-2.6: Each AMASS site must have the AMASS adaptation capability.	PASS			

dOM	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-2.7: Source: ORD 3.a.(2).\$3	MAOR-2.7: The AMASS adaptation capability must be menu-driven and allow the users to modify all adaptation parameters.	PASS			
It shall be available to the users via a menu selection capability in such a way that all selected adaptation parameters and sets of parameters may be specified and changed as needed.					
MOP-2.8: Source: ORD 3.d.(5).(a)	MAOR-2.8: The AMASS adaptation capability must allow for changes to the messages for any safety logic cell by changing the message	PASS			
The user, through adaptation, shall be able to: change the message for any safety logic cell by changing the message number in the data base to another existing message number.					
MOP-2.9: Source: ORD 3.d.(5).(b)	MAOR-2.9: The AMASS adaptation capability must allow for the modification of alert message composition.	PASS			
The user, through adaptation, shall be able to: modify the word composition within an alert message.					
MOP-2.10: Source: ORD 3.d.(5).(c)	MAOR-2.10: The AMASS adaptation capability must allow for the adjustment of volume level for the voice messages.	PASS			
The user, through adaptation, shall be able to: adjust the volume level of the voice messages.					
MOP-2.11: Source: ORD 3.r.(9)	MAOR-2.11: The AMASS adaptation capability must allow for 4-sided segment definition for each movement surface.	PASS			
Segment Definition. The AMASS shall permit defining segments (4-sided figures) for each movement surface as part of the adaptation process.					

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-2.12: Source: ORD 3.d.(3).(c).4.\$2	MAOR-2.12: The AMASS adaptation capability must allow for the toggling of the display of the safety logic cell identifier.	PASS			
This capability to display the safety logic cell identifier shall be able to be set "on" or "off" in the adaptation mode and					
MOP-2.13: Source: ORD 3.d.(3).(c).4.\$3	MAOR-2.13: The AMASS adaptation capability must default the safety logic cell identifier to "off".	PASS			
This capability to display the safety logic cell identifier shall default to the "off" setting.					:
MOP-3.1: Source: ORD 3.b.(1).\$1	MAOR-3.1: AMASS accepts input from the ASDE-3 keypad and keyboard.	PASS			
AMASS shall provide for the use of the ASDE-3 keypad and keyboard to control AMASS functions.					
MOP-3.2: Source: ORD 3.b.(1).\$2 Rapid Controller input shall be provided using "hot keys".	MAOR-3.2: AMASS provides for the use of "hotkeys".	PASS			
MOP-3.3: Source: ORD 3.b.(1).S3	MAOR-3.3.1: The "hot key" function is activated by depressing "Enter".	PASS			
Each "hot key" shall enable a unique function that can be activated by depressing the "Enter" key or canceled by depressing the "ESC" key.	MAOR-3.3.2: The "hot key" function is cancelled by depressing "ESC".				

PRIORITY								
PROPOSED SOLUTION								
ISSUE								
PASS/ FAIL	PASS		PASS		PASS		PASS	
MAOR	MAOR-3.4: An appropriate "hot key" must be used to switch the ASDE-3 keyboard and keypad to AMASS operations.		MAOR-3.5: The same "hot key" as described in MAOR-3.4 will return the keyboard/keypad to ASDE-3 functionality.		MAOR-3.6: The ASDE-3 keypad will be controlled using single keystrokes to activate functions while in AMASS operation.		MAOR-3.7:The ASDE-3 keypad will control additional functions using "hot keys".	
MOP	MOP-3.4: Source: ORD 3.b.(1).\$4	When AMASS is turned on, the ASDE-3 keyboard and keypads shall remain in the ASDE-3 keyboard and keypad operations (i.e., functionality) until the appropriate "hot key" has been activated to switch the keypads and keyboard to AMASS operations.	MOP-3.5: Source: ORD 3.b.(1).\$5	Once in AMASS operation a selection of the same "hot key" and its activation shall return the individual ASDE-3 keypad or keyboard to ASDE-3 functionality.	MOP-3.6: Source: ORD 3.b.(2).\$1	"Hot keys", which provide user access to functions, shall be controlled via the ASDE-3 keypad using a single keystroke to activate the functions while the system is in AMASS operation.	MOP-3.7: Source: ORD 3.b.(2).\$3	In addition to providing all of the keypad functions, other functions shall be controlled via the ASDE-3 keyboard using function "fot keys" to activate the function when the keyboard is in AMASS operation.

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.8: Source: ORD 3.b.(2).\$4	MAOR-3.8: Functions requiring a trackball slew will be preceded by depressing a "hot key".	PASS			
To activate a function which requires a trackball slew, a function "hot key" shall be depressed first.					
MOP-3.9: Source: ORD 3.b.(3).51	MAOR-3.9: While in AMASS operations, a "hot key" will provide for the display and access the operational menu.	PASS			
When the ASDE-3 keyboard has been switched to AMASS operations, a "hot key" on the ASDE-3 keyboard shall provide display of and access to the AMASS operational menu.					
MOP-3.10: Source: ORD 3.b.(3).\$2  The AMASS operational menu shall show all options and current selections, including each available runway configuration	MAOR-3.10: The AMASS operational menu must show all options and current selections including each available runway configuration.	PASS			
MOP-3.11: Source: ORD 3.b.(3).\$4	MAOR-3.11: The AMASS operational menu must allow for expansion of capabilities.	PASS			
The design of the menu shall provide expansion capability for other selections.					

PRIORITY			
PROPOSED SOLUTION			
ISSUE			
PASS/ FAIL	PASS	PASS	PASS
MAOR	MAOR-3.12.1 AMASS users must be able to select an applicable data base configuration when changing operational runway configurations and when environmental conditions change.  MAOR-3.12.2: The applicable data base configurations must have runway traffic flow definitions, selected filtering of alerts and other relevant parameters.	MAOR-3.13: The AMASS startup database must be modifiable in the off-line setup mode.	MAOR-3.14.1: Upon AMASS startup and when no startup database configuration has been selected, the previously saved database configuration must be used.  MAOR-3.14.2: Upon AMASS startup and when no startup database configuration has been selected and when no database configuration has been saved, the defined default startup database configuration must be used.
MOP	MOP-3.12: Source: ORD 3.c.(1).\$1  At the beginning of the use of each operational runway configuration, or when environmental conditions change, the users shall be able to select an applicable data base configuration which will have with it associated runway traffic flow definitions, selected filtering of alerts in specific areas, and other relevant parameters.	MOP-3.13: Source: ORD 3.c.(2).\$1 In the off-line setup mode, the user shall be able to select and modify a startup data base configuration that will be used when the system is activated into the operational state.	MOP-3.14: Source: ORD 3.c.(2).\$2  If a startup data base configuration is not selected at startup, the data base configuration that will be activated shall be either:  (a) The saved configuration that was in use when the system last transitioned from the operational state to the non-operational state, or  (b) If there is no saved configuration, a data base configuration, a data base configuration that has been defined as the default startup configuration.

PRIORITY								
PRI								
PROPOSED SOLUTION								
ISSUE								
PASS/ FAIL	PASS		PASS		PASS		PASS	
MAOR	MAOR-3.15: User input is not required to operate the AMASS functions when a startup database configuration is not selected.		MAOR-3.16: New database configurations are to be placed in effect immediately following the activation phase.		MAOR-3.17: AMASS must impose static and dynamic presentations on the ASDE-3 displays and produce aural alerts when safety logic cells are activated.		MAOR-3.18: When AMASS is on- line and fully operational the static display must include "AMASS operational status:	
MOP	MOP-3.15: Source: ORD 3.c.(3)	In these cases, on-line inputs by users shall not be required for the system to operate the AMASS functions that have been selected in advance for the normal operation of any runway configuration.	MOP-3.16: Source: ORD 3.c.(5).(c).\$2	The new data base configuration shall be placed in effect automatically at the activation phase ending time,	MOP-3.17: Source: ORD 3.d.(1).\$1	AMASS shall impose the following static and dynamic presentations on the ASDE-3 displays, as well as, producing aural alerts when specified events occur and are detected by the safety logic cells.	MOP-3.18: Source: ORD 3.d.(2).(a).1.\$1	When AMASS is on-line the static presentation shall include: AMASS operational status: OPERATIONAL" - a full operating mode, including an operating Terminal Automation Interface Unit (TAIU).

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.19: Source: ORD 3.d.(2).(a).1.\$2	MAOR-3.19: The TAIU must be operational for the AMASS to be operational.	PASS			
Note: AMASS shall not be in operating mode when the TAIU interface is not capable of sending data to the AMASS cabinet.					
MOP-3.20: Not used		PASS		•	
MOP-3.21: Source: ORD 3.d.(2).(a).3.\$1	MAOR-3. 21: When AMASS is on- line and in test mode the static display must include "AMASS operational status: TEST".	PASS			
When AMASS is on-line the static presentation shall include: AMASS operational status: "TEST" - for when AMASS is in a test state.					
MOP-3.22: Source: ORD 3.d.(2).(a).3.\$2	MAOR-3.22.1: When AMASS is in a TEST state, it must be capable of receiving live input from the ASDE-3.	PASS			
When AMASS is in a test state (and) it shall be capable of obtaining: live inputs from the ASDE-3 and TAIU (or the ASDE-3 only), input from	MAOR-3.22.2: When AMASS is in a TEST state, it must be capable of receiving live input from the ASDE-3 without the TAIU.				
recorded data playback; or a combination of recorded and live inputs.	MAOR-3.22.3: When AMASS is in a TEST state, it must be capable of receiving input from recorded data.				
	MAOR-3.22.4: When AMASS is in a TEST state, it must be capable of receiving a combination of live and recorded inputs.				

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.23: Source: ORD 3.d.(2),(b).1 When AMASS is on-line the static presentation shall include: AMASS off-line mode: "OFF_LINE"" - for when the AMASS is operating but has been placed off-line.	MAOR-3.23: When AMASS is on- line, operating, but has been placed off-line, the static display must include "AMASS operational status: OFF_LINE".	PASS			
MOP-3.24: Source: ORD 3.d.(2).(c).\$1 In addition to the display of the currently invoked AMASS mode, an indicator shall be provided as a companion to the full and limited operating mode identifications to denote that alerts are inhibited for one or more AMASS tracks, "TRK INHIB" or arrival tracks, "ARR TRK INHIB".	MAOR-3.24.1: Additional limited operating mode identifications must be presented on the static display when alerts are inhibited for one ore more AMASS tracks, "TRK INHIB".  MAOR-3.24.2: Additional limited operating mode identifications must be presented on the static display when alerts are inhibited for arrival tracks, "ARR TRK INHIB".	PASS			
MOP-3.25: Source: ORD 3.d.(2).(c).\$2  If alerts are inhibited from both AMASS and arrival tracks, both inhibit indicators shall be displayed with the operating mode identification.	MAOR-3.25: Both the "TRK INHIB" and ARR TRK INHIB" indicators must be displayed if the situations exist simultaneously.	PASS			
MOP-3.26: Source: ORD 3.d.(2).(c).53 A combination of mode and alert inhibit indicators shall be displayed if the situations exists simultaneously.	MAOR-3.26: Both the mode and alert inhibit must be displayed if the situations exist simultaneously.	PASS			

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.27: Source: ORD 3.d.(3).(a)	MAOR-3.27: The AMASS dynamic presentation must include hold bars at active runway intersections.	PASS			
The dynamic presentation shall include: Hold bars at intersections to active runways (see Hold Bar requirements).					
MOP-3.28: Source: ORD 3.d.(3).(b).\$1	MAOR-3.28: The AMASS dynamic presentation must include the location of alert icons around each involved track.	PASS			
The dynamic presentation shall include: Location of alert icons around a track(s) involved in the activated alert.					
MOP-3.29: Source: ORD 3.d.(3).(b).\$2	MAOR-3.29. The AMASS dynamic presentation alert icon must be non-directional.	PASS			
The dynamic presentation shall include: The alert icon on the ASDE-3 used to highlight the track(s) involved in the alert shall be nondirectional, preferably having an octagonal shape.					
MOP-3.30: Source: ORD 3.d.(3).(b).\$3	MAOR-3.30: Alert icons must remain centered on the AMASS track centroid for as long as the alert condition exists.	PASS			
The dynamic presentation shall include: During an alert situation, each alert icon shall be centered on the associated AMASS track centroid and remain displayed as long as the alert condition continues.					
MOP-3.31: Source: ORD 3.d.(3).(c)	MAOR-3.31: Alert text messages must be part of the dynamic display.	PASS			
The dynamic presentation shall include: Alert text messages.					

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.32: Source: ORD 3.d.(3).(c).S1	MAOR-3.32: Text messages must be displayed in the alert window on the ASDE-3 display when an alert is activated.	PASS			
When an alert is activated, a text message shall be displayed in the alert window on the ASDE-3 display in the same format as described for the voice (aural) alert messages.					
MOP-3.33: Source: ORD 3.d.(3).(c).\$2  The window in which the message is displayed shall be able to be relocated annihase on the ACDE 3 directors.	MAOR-3.33: The alert window must be able to be relocated anywhere on the ASDE-3 display.	PASS			
MOP-3.34: Source: ORD 3.d.(3).(c).1 Alert messages shall be displayed in all upper case characters.	MAOR-3.34: Alert messages must be in upper-case only.	PASS			
MOP-3.35: Source: ORD 3.d.(3).(c).3 Displayed alerts shall contain abbreviations for words furnished by Air Traffic.	MAOR-3.35: Alert messages must contain abbreviations as furnished by Air Traffic.	PASS			
MOP-3.36: Source: ORD 3.d.(3).(c).4.\$1 A capability shall be provided to display the safety logic cell identifier as a field that precedes the three fields of the alert message.	MAOR-3.36: The capability to display the safety logic cell identifier prior to the alert message must exist.	PASS			

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.37: Source: ORD 3.d.(3).(d)	MAOR-3.37: The dynamic presentation must include Arrival Indicator Lines and icon.	PASS			
The dynamic presentation shall include: Arrival Indicator Lines and icon.					
MOP-3.38: Source: ORD 3.d.(3).(f)	MAOR-3.38: The dynamic presentation must include simulation tracks.	PASS			
The dynamic presentation shall include: Simulation tracks.					
MOP-3.39: Not used.					
MOP-3,40: Not used.					
MOP-3.41: Source: ORD 3.d.(4).\$1 When an alert condition has been detected by AMASS, in addition to the display of the text message in the alert window and the track highlighting described above, a voice message composed of combinations of the words available in the Air Traffic furnished word dictionary shall be pronounced aurally.	MOP-3.41: A voice message composed of combinations of the words available in the Air Traffic furnished word dictionary must be pronounced aurally when an alert condition has been detected	PASS			
MOP-3.42: Not used.					

MOP MOP-3.43:	MAOR MAOR-3.43: Field 1 of 3, case 1 of 2	PASS/ FAIL PASS	ISSUE	PROPOSED SOLUTION	PRIORITY
Source: ORD 3.d.(4).(a).1	op pronounced alert messages must be "CAUTION" for single-track alerts.				
The format for pronounced alert messages shall consist of three fields: (field 1 of 3, case 1 of 2) Type of alert: "CAUTION" for single-track alerts.					
MOP-3.44: Source: ORD 3.d.(4).(a).2	MAOR-3.44: Field 1 of 3, case 2of 2 of pronounced alert messages must be "WARNING" for two-track alerts.	PASS			
The format for pronounced alert messages shall consist of three fields: (field 1 of 3, case 2 of 2) Type of alert: "WARNING" for two-track alerts.					
MOP-3.45; Source: ORD 3.d.(4).(b).\$1	MAOR-3.45: Field 2 of 3 of pronounced alert messages must be the alphanumeric identifier for the involved movement area.	PASS			
The format for pronounced alert messages shall consist of three fields: (field 2 of 3): The alphanumeric identifier for that movement area involved in the situation (e.g., "twoeight right" for runway 28R or "sierra" for taxiway S).					
MOP-3.46: Source: ORD 3.d.(4).(b).\$2	MAOR-3.46: Field 2 of 3 of the pronounced alert messages must use the ICAO alphabet for numeric and alphabetic identifiers.	PASS			
Pronouncements for field 2 of 3 shall use the ICAO phonetic alphabet for numeric and alphabetic identifiers of runways and taxiways,					

Å						
PRIORITY						
PROPOSED SOLUTION						
ISSUE						
PASS/ FAIL	PASS		PASS		PASS	PASS
MAOR	MAOR-3.47: An exception to MAOR-46 is that left, right, and center runway identifiers must be pronounced "left", "right", and "center".		MAOR-3.49: An exception to MAOR-46 is that for an intersection of a runway and a taxiway, the runway designation must be given first, followed by the word "at," followed by the taxiway identifier		MAOR-3.50: An exception to MAOR-46 is that for an intersection of two runways, the word "and" must be pronounced between runway identifiers.	MAOR-3.51: Field 3 of 3 of the pronounced alert messages must include the content of the message as prescribed by adaptation for each safety logic cell using the set of Air Traffic designated alert messages.
MOP	MOP-3.47: Source: ORD 3.d.(4).(b).\$3 except that pronouncements for field 2 of 3 left, right, and center runway identifiers shall be pronounced as "left, right and center."	MOP-3.48: Not used	MOP-3.49: Source: ORD 3.d.(4).(b).1 For an intersection of a runway and a	taxway, tre runway designation stain be given first, followed by the word "at," followed by the taxiway identifier (e.g., "one-left at whiskey" for runway 1L at taxiway W).	MOP-3.50: Source: ORD 3.d.(4).(b).2 For an intersection of two runways, the word "and," shall be pronounced between the runway identifiers (e.g., "two-eight left and one-niner right" for runway 28L and runway 19R).	MOP-3.51: Source: ORD 3.d.(4).(c) The format for pronounced alert messages shall consist of three fields: (field 3 of 3): Content of the message as prescribed by adaptation for each safety logic cell using the set of Air Traffic designated alert messages.

PRIORITY				
PRIC				
PROPOSED SOLUTION				
ISSUE				
PASS/ FAIL	PASS	PASS	PASS	PASS
MAOR	MAOR-3.52: An alert condition that appears and disappears in a time interval during which a previous voice message is being outputted must only be displayed	MAOR-3.53: The AMASS must provide a statistical analysis package to summarize alert data from the recorded log data file(s) of track data.	MAOR-3.54: The statistical analysis package must operate off-line, in normal time or fast time, as an aid in the rapid adjustment of all site parameter values during and after system installation.	MAOR-3.55: The statistical analysis package must provide a hard copy print out and an electronic text file.
MOP	MOP-3.52: Source: ORD 3.d.(6) Any alert condition that appears and disappears in a time interval during which a previous voice message is being outputted shall only be displayed (i.e., no voice message shall be issued).	MOP-3.53: Source: ORD 3.e.(1).\$1  The AMASS shall provide a statistical analysis package to summarize alert data from the recorded log data file(s) of track data.	MOP-3.54: Source: ORD 3.e.(1).\$2  The statistical analysis package shall operate off-line, in normal time or fast time, as an aid in the rapid adjustment of all site parameter values during and after system installation.	MOP-3.55. Source: ORD 3.e.(2) The statistical analysis package shall provide a hard copy print out and an electronic text file containing the following information:

PRIORITY					
PROPOSED SOLUTION					
ISSUE					
PASS/ FAIL	PASS	PASS	PASS	PASS	PASS
MAOR	MAOR-3.56: The statistical analysis package must include the date of report.	MAOR-3.57: The statistical analysis package must include the log period.	MAOR-3.58: The statistical analysis package must include the arport configuration and associated data base configuration file name(s).	MAOR-3.59: The statistical analysis package must include the list of inhibited cells.	MAOR-3.60: The statistical analysis package must include the list of cells invoking alert(s).
MOP	MOP-3.56: Source: ORD 3.e.(2).(a) The statistical analysis package shall	MOP-3.57: Source: ORD 3.e.(2).(b) The statistical analysis package shall include: Period of time covered (log period).	MOP-3.58: Source: ORD 3.e.(2).(c) The statistical analysis package shall include: Airport configuration and associated data base configuration file name(s).	MOP-3.59: Source: ORD 3.e.(2).(d) The statistical analysis package shall include: List of inhibited cells.	MOP-3.60: Source: ORD 3.e.(2).(e) The statistical analysis package shall include: List of cells invoking alert(s) including:

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.61: Source: ORD 3.e.(2).(e).1	MAOR-3.61: The statistical analysis package must include the list of cells invoking alert(s) including the cell number.	PASS			
The statistical analysis package shall include: List of cells invoking alert(s) including: cell number.					
MOP-3.62: Source: ORD 3.e.(2).(e).2 The statistical analysis package shall include: List of cells invoking alert(s) including: alert output message.	MAOR-3.62: The statistical analysis package must include the statistical analysis package shall include the list of cells invoking alert(s) including the: alert output message.	PASS			
MOP-3.63: Source: ORD 3.e.(2).(e).3 The statistical analysis package shall include: List of cells invoking alert(s) including: time of alert.	MAOR-3.63: The statistical analysis package must include the list of cells invoking alert(s) including the time of alert.	PASS			
MOP-3.64: Source: ORD 3.e.(3).\$1  The statistical analysis package printed report shall list the invoked alert cells chronologically and numerically by cell number.	MAOR-3.64: The statistical analysis package printed report must include the list the invoked alert cells chronologically and numerically by cell number. must include the date of report.	PASS			
MOP-3.65: Source: ORD 3.e.(3).\$2 In addition, the statistical analysis package printed report shall include a summary of the number of occurrences that each cell generated an alert during the log period.	MAOR-3.65: the statistical analysis package printed report must include a summary of the number of occurrences that each cell generated an alert during the log period.	PASS			

PROPOSED SOLUTION PRIORITY				
PASS/ FAIL ISSUE	PASS	PASS	PASS	PASS
MAOR	MAOR-3.66: The statistical analysis package must include the capability to rerun at a rapid pace the recorded track data to generate another summary report using a different data base configuration.	MAOR-3.67.1: Any caution alert involving a track which is also involved in a warning alert must not be issued if detected during the same 1 second scan.  MAOR-3.67.2: Any caution alert involving a track which is also involving a track which is also involved in a warning alert must be removed if already issued from the displayed active alert list.	MAOR-3.68: The caution alert involving a track which is also involved in a warning alert must be reissued if a caution alert situation still exists when the warning alert ceases.	MAOR-3.69: Modifications to the displayed alert list must be made on a complete radar scan basis.
dOM	MOP-3.66: Source: ORD 3.e.(4) The capability shall be provided by the statistical analysis package to rerun at a rapid pace the recorded track data to generate another summary report using a different data base configuration (i.e., changed parameter values).	MOP-3.67: Source: ORD 3.f.(1),(e).\$1 Any caution alert involving a track which is also involved in a warning alert shall not be issued if detected during the same 1 second scan or shall be removed (if already issued) from the displayed active alert list.	MOP-3.68: Source: ORD 3.f.(1).(e).\$2 The caution alert involving a track which is also involved in a warning alert shall be reissued if a caution alert situation still exists when the warning alert ceases.	MOP-3.69: Source: ORD 3.f.(1).(f).\$1  Modifications to the displayed alert list shall be made on a complete radar

PRIORITY				
PROPOSED SOLUTION				
ISSUE				
PASS/ FAIL	PASS		PASS	PASS
MAOR	MAOR-3.70: Voice message issuance modifications must be performed based on the availability of the voice processor.		MAOR-3.71: The display of alert messages and alert icons together with the aural alert message output must comply with MAOR-3.17 through MAOR-3.53.	MAOR-3.72: AMASS must provide for display of fixed hold bars at intersecting taxiways and runways for the full length of the runway in front of an oncoming departure, lander, or arrival track
MOP	MOP-3.70: Source: ORD 3.f.(1).(f).S2	but voice message issuance modifications shall only be performed based on the availability of the voice processor. For example, if the voice processor, is busy sounding a caution alert, and a warning alert is issued involving the same track, the voice processor shall complete the generation of the current caution alert, but the displayed caution message shall immediately be replaced by the warning message. Once the voice processor has completed output of the caution alert, the warning alert message shall be voiced.	MOP-3.71: Source: ORD 3.f.(1).(g) The display of alert messages and alert icons together with the aural alert message output shall comply with the "Display and Audio Output" requirements.	MOP-3.72: Source: ORD 3.n.(1).S1 AMASS shall provide for display of fixed hold bars at intersecting taxiways and runways for the full length of the runway in front of an oncoming departure, lander, or arrival track.

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.73: Source: ORD 3.n.(1).\$2	MAOR-3.73: The hold bar for an intersection must be eliminated as a departure or lander track passes that intersection.	PASS			
As the departure or lander track passes each intersection, the hold bar for that intersection shall be eliminated.					
MOP-3.74: Source: ORD 3.n.(1).\$3	MAOR-3.74: The hold bars for an arrival track must be activated when the track is a parameter distance from the runway threshold.	PASS			
The hold bars for an arrival track shall be activated when the track is a parameter distance from the runway threshold.					
MOP-3.75: Source: ORD 3.n.(1).\$4	MAOR-3.75: Hold bars must be displayed with a higher brightness level than the normal map and at the edge of the appropriate runway.	PASS			
The hold bars shall be displayed with a higher brightness level than the normal map and at the edge of the appropriate runway.					
MOP-3.76: Source: ORD 3.n.(1).\$5	MAOR-3.76: Hold bars must not be displayed at the runway-runway intersection of two intersecting active runways.	PASS			
Hold bars shall not be displayed at the runway-runway intersection of two intersecting active runways.					
MOP-3.77: Source: ORD 3.n.(2)	MAOR-3.77: AMASS must not provide moving hold bars.	PASS			
AMASS shall not provide moving hold bars.					

MOP		PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.78: Source: ORD 3.0.(1).51 This system shall record, retain for 15 days, and playback, all synchronized time-stamped data and alerts on the airport movement area, including up to the vertical coverage height of the ASDE-3.	MAOR-3.78: AMASS must record, retain for 15 days, and playback, all synchronized time-stamped data and alerts on the airport movement area, including up to the vertical coverage height of the ASDE-3.	PASS	Issue: The larger disk drives are not yet installed at the first three AMASS sites.	Larger Drives have been installed at all sites (6 gig drives) and will handle the 15 days of recording.	
MOP-3.79: Source: ORD 3.r.(6).\$1 Runway Configurations. The AMASS shall be capable of displaying up to 25 runway configurations, but	MAOR-3.79: AMASS must be capable of displaying up to 25 runway configurations.	PASS			
MOP-3.80: Source: ORD 3.r.(6).\$2 only the number of Runway Configurations established during adaptation shall be displayed or occupy display space.	MAOR-3. 80: Only the number of Runway Configurations established during adaptation must be displayed or occupy display space.	PASS			
MOP-3.81: Source: ORD 3.r.(7).\$1  Arrival Tags. The AMASS shall have the capability to continuously process up to 25 tags for landing aircraft tracks that are within the AMASS surface area.	MAOR-3.81: AMASS must have the capability to continuously process up to 25 tags for landing aircraft tracks that are within the AMASS surface area.	PASS			

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.82: Source: ORD 3.r.(7).\$2 The AMASS shall utilize arrival data and information on aircraft within the defined AMASS approach areas to determine the intended arrival runway.	MAOR-3.82: AMASS must utilize arrival data and information on aircraft within the defined AMASS approach areas to determine the intended arrival runway.	PASS			
MOS-3.83: Source: Derived from COI-3 Is the display presentation of AMASS and the alerts suitable to perform the AMASS mission?	MAOR-3.83.1: As determined by test team consensus, the implemented government provided list of text messages is suitable for performing the AMASS mission (Message content, font size track icons, multi-path icons, filter icons, alert icons and TA indicator).  MAOR-3.83.2: As determined by test team consensus, the implemented closed runway designation (an "X" at the ends of each closed runway) is suitable for performing the AMASS mission.	PASS			
MOS-3.84: Source: Derived from COI-3 Is the aural presentation of AMASS alerts suitable to perform the AMASS mission?	MAOR-3.84. As determined by test team consensus, the government provided list of aural messages is suitable for performing the AMASS mission (tone, diction, speed, message content).	PASS			
MOS-3.85: Source: Derived from COI-3 Does AMASS provide suitable controls to operationally control the system?	MAOR-3.85. As determined by test team consensus, the operational control provided by AMASS are suitable for performing the AMASS mission (Closing runways, Volume adjustment, Hot keys, controller/supervisor).	PASS			

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.1: Source: ORD 3.d.(8).\$1	MAOR 4.1: AMASS must provide an indicator to denote that alerts are inhibited for one or more AMASS tracks (i.e., "TRK INHIB") or one or more arrival tracks (i.e., "ARR INHIB") or one or more arrival tracks (i.e., "ARR TRK	PASS			
An indicator shall be provided to denote that alerts are inhibited for one or more AMASS tracks (i.e., "TRK INHIB") or one or more arrival tracks (i.e., "ARR TRK INHIB").	INHIB").				
MOP-4.2: Source: ORD 3.d.(8).\$2	MAOR 4.2: If alerts are inhibited from both AMASS and arrival recorded tracks, both inhibited indicators must be displayed.	PASS			
If alerts are inhibited from both AMASS and arrival recorded tracks, both inhibited indicators shall be displayed.					
MOP-4.3: Source: ORD 3.g.(1).S1	MAOR 4.3: AMASS must provide the capability for the users to inhibit all or some alerts for AMASS tracks through the use of the ASDE-3 keypad/keyboard.	PASS			
The users, via the ASDE-3 keypad/keyboard and trackball, shall be provided the capability to inhibit all or some alerts for specified AMASS tracks.					
MOP-4.4: Source: ORD 3.g.(1).\$3	MAOR 4.4. Alert inhibits must continue for an allocated parameter time period, or in the case of arrival aircraft track, until it crosses the manay threshold	PASS			
Each alert inhibit action shall continue for an allocated parameter time period, or in the case of arrival aircraft track, until it crosses the runway threshold.					

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.5: Source: ORD 3.g.(1).\$4	MAOR 4.5: After the allocated time period has elapsed, the previously selected track(s) must automatically return to their normal alert status.	PASS			
After the allocated time period has elapsed, the previously selected track(s) shall automatically return to their normal alert status allowing automatic activation of alerts.					
MOP-4.6: Source: ORD 3.g.(1).\$5	MAOR-4.6.1: AMASS must provide the capability to increment the inhibit time for any track(s) with a predetermined parameter time period.	PASS			
A capability shall be provided to increment the inhibit time for any track(s) with a predetermined parameter time period during the period in which the inhibit action remains in effect and the cumulative continuous inhibit time has not exceeded the total alert inhibit time parameter for the selected track(s).	MAOR-4.6.2: During this period, the inhibit action remains in effect as long as the cumulative continuous inhibit time has not exceeded the total alert inhibit time parameter for the selected track(s).				
MOP-4.7: Source: ORD 3.g.(2).\$1	MAOR-4.7: Selective Aircraft Filtering must use three separate "hot keys".	PASS			
Three separate "hot keys" shall be provided for selective aircraft filtering.					
MOP-4.8: Source: ORD 3.g.(2).\$3	MAOR-4.8: The selection of one of the three hotkeys, along with the use of the trackball, must identify the desired selective aircraft filtering function and track(s).	PASS			
The selection of one of the three "hot keys" along with the trackball shall be used to identify the desired selective aircraft filtering function and track(s).					

PRIORITY								
PROPOSED SOLUTION P								
ISSUE								
PASS/ FAIL IS	PASS	2004-010-0	PASS		PASS		PASS	
MAOR	MAOR-4.9: "Hot key," 1 of 3 must inhibit all alerts for up to three simultaneous AMASS tracks.		MAOR-4.10. "Hot key," 2 of 3 shall inhibit all single-track alerts for up to three simultaneous AMASS tracks		MAOR-4.11: MAOR-4.10 must take 1 precedence over MAOR-4.9.		MAOR-4.12: AMASS must provide I the capability to extend an inhibit alert time by using the same hot key and trackball combination.	
MOP	MOP-4.9: Source: ORD 3.g.(2).(a)	"Hot key" I of 3 shall be: Inhibit all alerts for up to three simultaneous AMASS tracks.	MOP-4.10: Source: ORD 3.g.(2).(b)	"Hot key" 2 of 3 shall be: Inhibit all single-track alerts for up to three simultaneous AMASS tracks.	MOP-4.11: Source: ORD 3.g.(3)	The "Inhibit all alert" function shall have priority over the "Inhibit all single-track alert" capability.	MOP-4.12: Source: ORD 3.g.(4).S1	Through the use of the appropriate "hot key" (i.e., the same key used to originally inhibit the track) and trackball, a capability shall be provided for a user to extend an inhibit alert time by adding a time increment parameter to the remaining alert time before the inhibiting time

PRIORITY					
PROPOSED SOLUTION			·		
ISSUE					
PASS/ FAIL	PASS		PASS	PASS	PASS
MAOR	MAOR-4.13: The capability to extend an inhibit alert time must not exceed 15 minutes.		MAOR-4.14: Once the total cumulative inhibit time expires on any designated track, it must be possible to reinitiate this process on that track.	MAOR-4. 15: As long as any AMASS track is inhibited, the "TRK INHIB" message must be displayd.	MAOR-4.16: "ARR TRK INHIB." must be displayed with the AMASS mode indicator when one or more arrival tracks are inhibited and remain displayed until the last arrival that is inhibited crosses the arrival runway threshold.
MOP	MOP-4.13: Source: ORD 3.g.(4).\$2	a user may extend an inhibit alert time with the restriction that the total inhibiting time shall not exceed 15 minutes. This "hot key" can be used continuously to add additional time to the same track, but not to exceed the 15 minutes.	MOP-4.14: Source: ORD 3.g.(4).\$3  Once the total cumulative inhibit time expires on any designated track, it shall be possible to reinitiate this process on that track, but, only by again selecting the track as described above. A de-inhibiting capability is not required.	MOP-4.15: Source: ORD 3.g.(5).\$1 A track inhibit message, "TRK INHIB," shall be displayed with the AMASS mode indicator as long as any AMASS track is inhibited.	MOP-4.16: Source: ORD 3.g.(5).\$2 Additionally, another track inhibit message, "ARR TRK INHIB," shall be displayed with the AMASS mode indicator when one or more arrival tracks are inhibited and remain displayed until the last arrival that is inhibited crosses the arrival runway threshold.

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.17: Source: ORD 3.g.(5).S3	MAOR-4.17: Tracks within the approach area within a parameter distance to the threshold at the time of activation must be inhibited for as long as they remain original tracks	PASS			
All tracks within the approach area within a parameter distance to the threshold at the time of activation shall be inhibited for as long as they remain arrival tracks;	TOUGS as they remain annyal tracks				
MOP-4, 18: Source: ORD 3.g.(5).\$4	MAOR-4.18: New tracks entering the approach area subsequent to the activation of the arrival track inhibit function must not be inhibited.	PASS			
however, new tracks entering this approach area shall not be inhibited.					
MOP-4.19: Source: ORD 3.g.(6).51	MAOR-4.19:Graphic, text, and voice processing with alerts associated with the selected track(s) all must be inhibited when	PASS			
When applicable alerts involving a track have been inhibited via one of the "hot key" operations, the effect shall be to inhibit graphic, text, and voice processing with alerts associated with the selected track(s).	applicable alerts involving a track have been inhibited. Via one of the hot key.				
MOP-4.20: Source: ORD 3.g.(6).\$2	MAOR-4.20: The display and voice alert processing for a track that has been inhibited must automatically be enabled after the inhibit alert time parameter has alonged.	PASS			
The display and voice alert processing for a track that has been inhibited shall automatically be enabled after the inhibit alert time parameter has elapsed.					

MOM	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.21: Source: ORD 3.g.(7).\$1	MAOR-4.21: The inhibit alert time parameter for each of the first two "hot keys" must be selectable between 0 and 10 minutes in one-balf minutes incorporation.	PASS			
An inhibit alert time parameter for each of the first two "hot keys" shall be selectable between 0 and 10 minutes (in one-half minute increments) to specify how long alerts associated with the selected track(s) are to be inhibited.	nail minue meteris.				
MOP-4.22: Source: ORD 3.g.(7).\$2	MAOR-4.22: The inhibit alert time increment parameter must be selectable between 0 and 4 minutes in one-half minute increments to	PASS			
An inhibit alert time increment parameter shall be selectable between 0 and 4 minutes (in one-half minute increments) to specify the time to be added to the existing inhibit alert time.	specify the time to be added to the existing inhibit alert time.				
MOP-4.23: Source: ORD 3.g.(7).\$3	MAOR-4.23: The inhibit icon display time parameter must be selectable in 1 second increments between 1 and 2 seconds.	PASS			
The inhibit icon display time parameter shall be selectable in 1 second increments between 1 and 2 seconds).					
MOP-4.24: Source: ORD 3.g.(7).\$4	MAOR-4.24: These inhibit time parameters must be modifiable from the PC platform.	PASS			
These inhibit time parameters shall be modifiable from the PC platform.					

MOP MOP 4 25.	MAOR WAOR The total cumulative	PASS/ FAIL PASS	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.25: Source: ORD 3.g.(7).\$5	MAOK-4.25: The total cumulative, consecutive alert-time for-inhibiting an alert on any track must not exceed 15 minutes.	rass			
An Additional parameter shall be provided to assure that the total cumulative, consecutive alert-time for-inhibiting an alert on any track will not exceed 15 minutes.					
MOP-4.26: Source: ORD 3.g.(7).S6	MAOR-4. 26: In the event that an inhibit alert action and any subsequent alert inhibit action(s) on one or more tracks that produces a time that exceeds a cimulative fotal	PASS			
In the event that an inhibit alert action and any subsequent alert inhibit action(s) on one or more tracks that produces a time that exceeds a cumulative total of 15 minutes, the alert output shall be automatically enabled after 15 minutes.	minutes.				
MOP-4.27: Source: ORD 3.h.(1).\$1	MAOR-4.27: AMASS must allow for the creation and execution of stopped track alert inhibit timeout values, assigned to each runway	PASS			
AMASS shall allow for the creation and execution of stopped track alert inhibit timeout values, assigned to each runway within a specific runway configuration.					
MOP-4.28: Source: ORD 3.h.(1).S2	MAOR-4.28: The user of an ASDE-3 keypad/keyboard and trackball must be provided the capability to add time to extend the stopped track alert inhibit timeout period.	PASS			
The user of an ASDE-3 keypad/keyboard and trackball shall be provided the capability to add time to extend the stopped track alert inhibit timeout period.					

		PASS/			
MOP	MAOR	FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.29: Source: ORD 3.h.(1).\$3 After the allocated time period has elapsed, the previously selected	MAOR-4. 29: After the allocated time period has elapsed, the previously selected track(s) must automatically return to the normal alert status allowing automatic activation of alerts.	PASS			
track(s) shall automatically return to the normal alert status allowing automatic activation of alerts.					
MOP-4.30: Source: ORD 3.h.(2).\$1	MAOR-4.30: On the ASDE-3 keypad and keyboard, a "hot key" must be provided to extend a stopped track alert inhibit timeout period.	PASS			
On the ASDE-3 keypad and keyboard, a "hot key" shall be provided to extend a stopped track alert inhibit timeout period.					
MOP-4.31: Source: ORD 3.h.(2).\$2	MAOR-4.31: The trackball must be used to identify the track on which the stopped track alert inhibit timeout is directed.	PASS			
The trackball shall be used to identify the track on which the stopped track alert inhibit timeout is directed.					
MOP-4.32: Source: ORD 3.h.(2).\$3	MAOR-4.32. Before the initial stopped track timeout has expired, the timeout period for the identified track must be extended through a cultocation of the same	PASS			
Before the initial stopped track timeout has expired, the timeout period for the identified track shall be extended through a subsequent activation of the same "hot key."	"hot key."				

ISSUE PROPOSED SOLUTION PRIORITY			
MAOR FAIL	MAOR-4.33: The total extended alert inhibit timeout period must equal the sum of the remaining stopped track alert timeout value plus a parameter time.	MAOR-4.34; Prior to the track moving, the AMASS must only activate one alert, but the alert icon must remain until the track moves.	MAOR-4.35: I the track stops again, PASS an initial alert inhibit timeout parameter must be initiated without any extended time.
MOP	MOP-4.33: Source: ORD 3.h.(2).\$4  The total extended alert inhibit timeout period shall equal the sum of the remaining stopped track alert timeout value plus a parameter time. For example, if the initial timeout period is set to 3 minutes at any time during the 3-minute interval, it shall be possible to add an additional 3 minutes to the alert inhibit time as long as the maximum stopped track alert inhibit time does not exceed the maximum stopped track alert inhibit time parameter.	MOP-4.34: Source: ORD 3.h.(2).\$6 Prior to the track moving, the AMASS shall only activate one alert, but the alert icon shall remain until the track moves.	MOP-4.35: Source: ORD 3.h.(2).57  If the track stops again, an initial alert inhibit timeout parameter shall be

PRIORITY				
PROPOSED SOLUTION				
ISSUE	·			
PASS/ FAIL	PASS	PASS	PASS	PASS
MAOR	MAOR-4.36: the user must be able to extend the stopped track alert inhibit timeout period if the stopped track timeout has not expired and the track continues to be stopped.	MAOR-4.37: A track inhibit message, "TRK INHIB," must be displayed with the AMASS mode indicator for as long as any stopped track is inhibited	MAOR-4.38: When alerts involving a stopped track have been inhibited via a "hot key," the effect must be to inhibit graphic, text, and voice processing associated with the selected track(s).	MAOR-4.39: The display and voice alert processing for a track that has been inhibited must automatically be enabled after the appropriate inhibit stopped track alert time parameter has elapsed.
MOP	MOP-4.36: Source: ORD 3.h.(2).\$8 However, the user shall be able to extend the stopped track alert inhibit timeout period if the stopped track timeout has not expired and the track continues to be stopped, provided that the maximum stopped track alert inhibit time parameter has not been exceeded.	MOP-4.37: Source: ORD 3.h.(3) A track inhibit message, "TRK INHIB," shall be displayed with the AMASS mode indicator for as long as any stopped track is inhibited.	MOP-4.38: Source: ORD 3.h.(4).\$1 When alerts involving a stopped track have been inhibited via a "hot key," the effect shall be to inhibit graphic, text, and voice processing associated with the selected track(s).	MOP-4.39: Source: ORD 3.h.(4).\$2 The display and voice alert processing for a track that has been inhibited shall automatically be enabled after the appropriate inhibit stopped track alert time parameter has elapsed.

PRIORITY				
PROPOSED SOLUTION				
ISSUE				
PASS/ FAIL	PASS	PASS	PASS	PASS
MAOR	MAOR-4.40: The stopped track alert inhibit timeout parameter must be selectable for each runway between 0 and 10 minutes in one-half minute increments.	MAOR-4.41; The parameter for the stopped track alert inhibit timeout increment must be selectable between 0 and 4 minutes in one-half minute increments	MAOR-4.42: The maximum time for a stopped track alert inhibition parameter must be selectable between 0 and 10 minutes in onehalf minute increments.	MAOR-4.43: The stopped track alert inhibit timeout parameter must not be accessible via the ASDE-3 interface, but must only be modifiable from the PC platform.
MOP	MOP-4.40: Source: ORD 3.h.(5).\$1  The stopped track alert inhibit timeout parameter shall be selectable for each runway between 0 and 10 minutes in one-half minute increments.	MOP-4.41: Source: ORD 3.h.(5).52 The parameter for this stopped track alert inhibit timeout increment shall be selectable between 0 and 4 minutes in one-half minute increments.	MOP-4.42: Source: ORD 3.h.(5).53 The maximum time for a stopped track alert inhibition parameter shall be selectable between 0 and 10 minutes in one-half minute increments.	MOP-4.43: Source: ORD 3.h.(6).\$1 The stopped track alert inhibit timeout parameter shall not be accessible via the ASDE-3 interface, but shall only be modifiable from the PC platform.

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-4.44: Source: ORD 3.h.(6).\$2	MAOR-4.44: The stopped track alert PASS inhibit timeout parameter, the stopped track alert inhibit timeout increment parameter, and the maximum time for stonged track	PASS			
The stopped track alert inhibit timeout parameter, the stopped track alert inhibit timeout increment parameter, and the maximum time for stopped track alert inhibition parameter shall be part of the AMASS data base configuration.	naturation in the part of the AM4 configuration				

## APPENDIX B AT OT Issue Matrix

## AMASS AT OT ISSUE LIST

For the issues identified below, criticality has been defined as follows:

- High A problem that will prevent, degrade, or interrupt operational service or jeopardize safety, and has no acceptable work-around.
- Medium To prevent, degrade, or interrupt operational service or jeopardize safety, but has an acceptable work-around.
- Low The issue constitutes an improvement to the operational use of AMASS and can be resolved through postcommissioning modifications. •

OPEN/ CLOSED		CLOSED	CLOSED	CLOSED	CLOSED
Priorty					
RESOLUTION/STATUS		Add the capability to allow an AMASS segment to have an infinite confidence level count. (See AMASS STR-PROD-0006.)	Resolve the error in the AMASS multi-path algorithm by fixing the multi-path lines error. (See AMASS STR-PROD-0001.)	Resolve the computational error in the multi-path algorithm, (See AMASS STR-PROD-0003.)	Determine an operational procedure for transitioning from/to the "RAIN" configuration in poor weather. (The AMASS Work Group is working the Supervisor procedures to handle this issue.)  Develop a "rain" operational configuration that turns off safety logic on ground tracks until the rain
DESCRIPTION	The current AMASS implementation cannot be adapted to reduce false tracks and false alerts to an acceptable level. Contributing issues are listed below.		Some real tracks are not transitioned to "real" track status due to the AMASS multi-path algorithm.	The multi-path algorithm does not correctly identify false tracks in certain situations.	AMASS generates false tracks and false alerts in heavy rain.
TITLE	False Tracks and False Alerts	False Tracks and False Alerts	False Tracks and False Alerts	False Tracks and False Alerts	False Tracks and False Alerts
- S S D E	,	1a	119	2	19

OPEN/	CLUSED	CLOSED		CLOSED	CLOSED	CLOSED	CLOSED	CLOSED	CLOSED	OPEN
e e	Frioriy									Т
STAR A POLICY TO GET	conditions improve.	AMASS drops the track when it leaves a valid surface. (See AMASS STR-PROD-0005.)		TAIU software sends data within 1 second of the track entering the runway's approach zone.  Also the AMASS alert logic does not process arrival alerts until an arrival track is within a parameter distance of the threshold.	AMASS allows taxi to departure transition speeds above 100 ft/sec.  And AMASS includes the track's acceleration as an additional parameter in the taxi to departure transition	Resolve AMASS STR-PROD-0008.	AMASS projects tracks taxiing across the runway "off" of the runway when appropriate(Table 6 alerts)	Resolve AMASS STR-PROD-0009.	The AMASS Work Group evaluate the alert and will keep the current setting to 20 secs.	Reevaluate the need for this function as additional
	DESCRIPTION	False tracks can reach real track status on a taxiway and then move across the grass and onto runway surfaces resulting in false alerts.	The current AMASS implementation cannot be adapted to reduce nuisance alerts to an acceptable level. Contributing issues are listed below:	The TAIU may not provide a track update for 4 seconds after a track crosses the runway approach zone.	Setting the taxi to departure transition speed to the allowable maximum of 100 ft/sec may not remove all nuisance alerts due to vehicles.	Analysis of recorded data found some situations in which a taxi crossing the runway did not create an appropriate alert.	Taxis crossing runways cause nuisance alerts.	The initial velocity calculation made by AMASS is sometimes greater than the actual velocity. This causes a track to be projected too far down the runway, creating nuisance alerts.	Lander chasing a Taxi Scenario: The OT Test Team members felt that this alert would be more useful to the controller if given earler. The OT Test Team members felt that the controller still had time to prevent the collision, but the situation would not be pretty. The current setting is 20 secs.	AMASS does not include the capability to define
r keep	HILE	False Tracks and False Alerts	Nuisance Alerts	Nuisance Alerts	Nuisance Alerts	Nuisance Alerts	Nuisance Alerts	Nuisance Alerts	Nuisance Alerts	Two Way
SSD	<b>-</b>	le	2	2a	2b	2c	2d	2e	2f	6

OPEN/ CLOSED	CLOSED	CLOSED	CLOSED	CLOSED	OPEN	CLOSED	CLOSED	CLOSED	OPEN	CLOSED	CLOSED	CLOSED
Priorty					I	M			M			
RESOLUTION/STATUS alert cells are enabled in the future. (This function will be re-evaluated by the AMASS	Work Group at a later time) 6gig Hard drives have been install at all current AMASS sites.	AMASS contains an "AMASS Test Message" command to verify the alert speaker volume.	Integrate the AMASS Utilities Menu into a single AMASS Main Menu.	This was integrated into the AMASS Utilities Menu	This requires a Table update in the AMASS source code. (This action will be passed onto AOS as enhancement to the AMASS system)	The keypad overlay should be redesigned.  (The AMASS Work Group decided not to change the Keypad overlay based on the OT Test Team member's comments.)	The keypad overlay should be affixed permanently to the keyboard without use of adhesive substances.	AMASS Training was conducted on June 20 <sup>th</sup> at ATL. The AT OT Test Members had training in the AMASS User's Manual and AT Procedurs.	Provide a video demonstrating each AMASS alert scenario on the potential collisions.	Provide ASDE-3 user interface refresher training as part of the AMASS training.	Develop a recurrent AMASS AT Training course.	The AIMASS Work Group is currently developing the Supervisor procedures which will give guidance on handling a false alert.
DESCRIPTION two way traffic flows on runways and taxiways.	AMASS cannot record 15 days of operational data.	AMASS does not include a suitable means of checking the alert speaker volume.	The process to open/close runways and change operational configurations is cumbersome.	The AMASS Main Menu does not provide a means to return to the ASDE-3 Main Menu.	AMASS hotkey configuration should be reconfigured.	Keypad overlay should use the assigned key names with a look-down list to the side with a mapping of each key command for AMASS	Keypad overlay is removable and possible misplaced.	AT Training could not be assessed because it has yet to be definitized.	AT Training should include a clear and concise presentation on the AMASS Alerts.	Some controllers may not be comfortable with the ASDE-3 user interface.	Recurrent AMASS AT Training may be necessary to refresh users on the AMASS user interface.	Supervisor's will need a procedure on handling a False Alert
TITLE Traffic	Data Recording	AMASS User Interface	AMASS User Interface	AMASS User Interface	AMASS User Interface	AMASS User Interface	AMASS User Interface	Training	Training	Training	Training	Training
I S S D H	4	5a	56	5c	Şd	Se	Sf	6a	99	39	<b>p</b> 9	99

OPEN/ CLOSED	CLOSED	CLOSED	OPEN	OPEN	CLOSED	CLOSED	CLOSED	CLOSED	OPEN
Priorty			X	X					٦
RESOLUTION/STATUS	The AMASS Work Group has change the AT Procedures to clairify the confusion	The AT Users Manual has been updated with this information.	Include a Quick Reference Card to summarize the AMASS commands (in addition to the planned Mini-DCU keypad template.)  (The AMASS Work Group may develop a quick reference card.)	Modify AMASS to support the full ASDE-3 range coverage of up to 24,000 (STR has been written by Norden).  This problem will be fixed prior to DFW and DEN going ORD.	Update the AMASS ORD to reflect the proposed/implemented design changes	ACT has assisted AOS and Air Traffic in developing the plan and procedures.	Assist Air Traffic in developing an optimized alert set to support the AMASS Operational Procedures. Perform AMASS OT Regression and Retest.	An STR was written by NORDEN (STR #39). This STR will be fixed prior to SFO ORD phase.	This will reduce the nuisance alerts. AMASS would be able to tell the TAIU when to change airport configurations (currently TAIU uses only one airport configuration for all operations). Aso arrival hand-offs could be confirmed between TAIU and AMASS.
DESCRIPTION	AT Procedures: The words Operational/Useability was confusing to the AT Controllers during the training.	The AT Users Manual does not include instructions on how to set and verify the volume setting of the alert speakers.	The AT Users Manual provides too much information for use by a controller on a day to day basis.	AMASS is currently limited to 12,000 ft. of movement area coverage from the antenna.	The April 1999 Human Factors Evaluation resulted in AMASS design changes that need to be captured in the AMASS ORD	A detailed adaptation/optimization plan and procedures are need to be developed and approved by Air Traffic to support the implementation of the 34 AMASS systems.	Until finalized AMASS Operational Procedures and an approved alert set is available, AMASS OT cannot be completed.	A departure takes off over a multipath track. The multipath track becomes real causing alerts while the departure is dropped from the alert logic.	Bidirectional Interface between AMASS and TAIU
TITLE	Training	Documentation	Documentation	Inadequate Airport Movement Area coverage	AMASS ORD Inconsistencies	AMASS site optimization	AMASS OT Incomplete	Multipath Target	Bidirectional Interface
I S C C	19	7a	J.	∞	6	10	11	12	13

OPEN/ Priorty CLOSED	L OPEN	CLOSED	CLOSED	L OPEN
RESOLUTION/STATUS	This could help increase the number of tracks in safety logic and reduce the number of false alerts.	The problem may be fixed by resizing the Clutter segments. AOS is currently working on redrawing the clutter maps at SFO, ATL and DTW. (This will be evaluated during the Final Data collection effort.)  An STR was written by NORDEN (STR #40) and further investion into the problem is currently be done.	Final Data collection was completed on August 31st, False Alert rate has dropped significally.	The audio amp has been re-designed/tested at SFO
DESCRIPTION	Controller slewing and enabling or disabling tracks into Safety Logic.	10-20 Departure Tracks are being dropped per day.	AMASS False Alert Rate, TAIU new software build/adaptation, and AMASS adaptation changes requires a final data collection effort.	Due to the size of the AMASS audio amp, a suitable location in the Tower Cab at all 34 sites may not be available.
TITLE	Enabling and Disabling Tracks	Dropped Tracks due to the Clutter Map	Data Collection Analysis	Audio AMP
ECSSI	41	15	16	17

## APPENDIX C

AT OT, APS Sub-Test MOP/MOAR Result Matrix

Test Result Matrix for ATO-2, APT

Test Date(s):7/19/99 to 8/13/99

Test Lead: Jeff Livings

Test Engineer: Chuck Dudas

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-1.27:	MAOR-1.27.1: AMASS PoD	PASS			
3041ce; OND 3.1.(3).32	and raise detection fates must not be affected fair weather, rain				
Neither target detection nor false	up to 16 mm/hour and snow				
detection rates shall be degraded	conditions.				
in weather conditions throughout	MAOR-1.27.2: As determined				
the AMASS coverage area	by test team consensus, AMASS				
including fair weather, rain levels	false detection rates in fair				
up to and including 16 nm/hour;	weather, rain and snow				
and snow conditions.	conditions are suitable for				
	AMASS operations.			The second secon	
MOP-1.31:	MAOR-1.31: As determined by	PASS			
Source: Derived from COI-1	test team consensus, the alerts				
	needed to support AT operations				
Does the AMASS provide	are turned on and provide				
controllers with suitable alerts?	suitable coverage (parameters)				
	for all required airport				
	configurations.				
MOP-2.14:	MAOR-2.14: As determined by	PASS	See AMASS AT OT	Status: June 2000, False Alert Rate has dropped significiantly to	
Source: Derived from COI-2	test team consensus, the AMASS		Issues 2b,2c,2d,2e.	approximately 2/month.	
	false alert rate does not				
Do the AMASS adaptation	adversely affect airport				
capabilities allow for a false alerts	operations or the controllers				
rate suitable for performing the	ability to perform the assigned				
AMASS mission?	duties.				
MOP-2.15:	MAOR-2.15: As determined by	PASS.	See AMASS AT OT	Status: June 2000, Nuisance Alert Rate has dropped significiantlly due to	
Source: Derived from COI-2	test team consensus, the AMASS		Issues 1a,1b,1c,1d,1e	the new AMASS Build and adaptation changes.	
	nuisance alert rate does not				
Do the AMASS adaptation	adversely affect airport				
capabilities allow for a nuisance	operations or the controllers				
alert rate suitable for performing	ability to perform the assigned				
THE STATES THISSION:	dudes.				

### APPENDIX D

AT OT, AMASS Parameter Listing

# **AMASS Parameters**

Arrival to Occupied RWY

TIME TO COORDINATION			
		Curre	Current Setting
Situation	Cell #	Time	Distance
Arr ch Dep	1.5.1.c/1.1.5.h	20	3000
Arr ch Abort	1.5.2.c/1.2.5.h	20	3000
Arr ch Taxi	1.5.4.c/1.4.5.h	50	3000
Arr ch Lnd	1.5.3.c/1.3.5.h	50	3000
Arr ho Dep	1.5.1.d/1.1.5.d	40	15000
Arr ho Abort	1.5.2.d1.2.5.d	40	15000
Arr ho Taxi	1.5.4.d/1.4.5.d	30	6000
Arr ho Lnd	1.5.3.d/1.3.5.d	40	15000
Arr vs Stop	1.5.6.b/1.6.5.d	20	3000
Arr w/Taxi Enter	6.4.5.c/6.4.5.d	20	3000
Arr w/Taxi Leaving	6.4.5.g/6.4.5.h	20	3000
Arr w/Stop Over			
Hold Line	6.6.5.b/6.6.5.d	20	3000

## Arrival to Closed Runway

Situation	Cell #	TAIU	TAIU Threshold
Arr Clsd RWY	19.2.5.a/19.2.5.b		4000 feet

Lander to Occupied Runway

		Curre	Current Setting
Situation	Cell #	Time	Distance
Lnd ch Dep	1.3.1.c/1.1.3.h	30	3000
Lnd ch Abort	1.3.2.c/1.2.3.h	30	6000
Lnd ch Taxi	1.3.4.c/1.4.3.h	20	3000
Lnd ch Lnd	1.3.3.c/1.3.3.h	30	0009
Lnd ho Dep	1.3.1.d	40	15000
Lnd ho Abort	1.3.2.d/1.2.3.d	40	15000
Lnd ho Taxi	1.3.4.d/1.4.3.d	30	0009
Lnd ho Lnd	1.3.3.d	40	15000
Lnd vs Stop	1.3.6.b/1.6.3.d	30	0009
Lnd w/Taxi Enter	6.4.3.c/6.4.3.d	30	0009
Lnd w/Taxi Leaving6.4.3.g/6.4.3.h	6.4.3.g/6.4.3.h	30	0009
Lnd w/Stop Over			
Hold Line	6.6.3.b/6.6.3.d	30	0009

Departure to Occupied Runway

Setting			Curre	<b>Current Setting</b>
stance	Situation	Cell #	Time	Distance
3000	Dep ch Dep	1.1.1.c/1.1.h	40	1000
0009	Dep ch Abort	1.1.2.c/1.2.1.h	40	15000
3000	Dep ch Taxi	1.1.4.c/1.4.1.h	40	15000
9009	Dep ch Lnd	1.1.3.c/1.3.1.h	40	15000
2000	Dep ho Dep	1.1.1.d	40	15000
5000	Dep ho Abort	1.1.2.d/1.2.1d	40	15000
0009	Dep ho Taxi	1.1.4.d/1.4.1.d	40	15000
5000	Dep ho Lnd	1.1.3.d	40	15000
0009	Dep vs Stop	1.1.6.b/1.6.1.d	40	15000
0009	Dep w/Taxi Enter	6.4.1.c/6.4.1.d	40	15000
0009	Dep w/Taxi Leaving	6.4.1.g/6.4.1.h	40	15000
0009	Dep w/Stop Over Hold Line	6.6.1.b/6.6.1.d	40	15000

# **Movement State Transition**

### Velocity

(2000)		
Transition States	ft/s	knots
Stop to Taxi	2	4
Taxi to Departure	80	47
Departure Abort to Taxi	06	53
Taxi to Stop	4	7
Landing to Taxi	100	29
None to Landing	09	36

## Acceleration

ft/s^2	
9	
Taxi to Departure	

# Departure to Airborne Departure

Velocity	125	tt/s
	74	knots
Acceleration	3.5	ft/s

## Holdlines/Projections

Initial SFO Hold Lines	125'	Revised SFO & DTW Hold Lines: 110'
All K factors set to	8	

TAIU Threshold Value =

6000 feet

### APPENDIX E

AT OT, OET Sub-Test Questionnaires (July 1999)

Summary of test team responses to the ATO-2, OET, Operational Events Test questionnaire	
Case 1a, Cell 1.5.1.c, Arrival Chasing a Departure When following the Draft ATC AMASS Operational Procedures, how does the	<b>SYS2, 13066, INJECT TESTH-0007(a) 16:46:00</b> Test team responses:
(3	AMASS did not alarm and should not have. No collission could have occurred.
	✓ No alert.
Negatively No Effect Positively 1 2	✓ No alert. ✓ No possible collision.
4	
Case 1b, Cell 1.5.1.c, Arrival Chasing a Departure	SYS2, T72.11755@17.55.10
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
the top top top and the formal to bottom bottom and provided the formal top	have occurred.
;	V No alert. Situation was tight/close. From mandatory go around
Negatively No Effect Positively	mindset, n/a,- however, in this scenario an alert to call my
	attention to the situation would be useful.  No alert
	✓ Look for collision.
Case 1c, Cell 1.5.1.c, Arrival Chasing a Departure	SYS1, <u>14181926@19:25:45</u>
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	AMASS did not alarm and should not have. No collision could
	have occurred.  Na. no alert. This was a DTW scenario. I'm unfamiliar with
Negatively No Effect Positively	DTW's way of doing business.
1 2 3 4 5	✓ No alert
4	✓ No alert
	<i>&gt;</i>

When following the Draft ATC AMASS Operational Procedures how does the	<b>SYS2</b> ; <b>13000 INJECTATEST 1-</b> -0009(@16;46:02)  Test team responses:
AMASS response affect your ability to perform your assigned duties?	1 cot to and 1 copounded.
	Alarm seemed to trigger soon enough but not too early.
1	✓ Mandatory go around in this scenario is appropriate. Note: This
Negatively No Effect Positively	is an injected target and looks like it If it were a true situation-
2	the arrival would be slowing down.
	Caught traffic still on RWY.
	✓ Alert was appropriate for this situation. However, if a/c is
	further down runway or near a high speed exit, I don't think it would be needed.
Case 3, Cell 1.5.3.c, Arrival Chasing Lander	SYS2, T3066 INJECT TEST2-0000@16:47:05
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	A collision was not imminent so an alarm should not have gone
į,	110
No Effect Po	Andatory go around alert occurred too early in the scenario.
3	I his secenario occurs a lot in AIL- and the controller would be evaluating and massaging the situation
	Alert did not indicate the possibility of collision.
	✓ Go around issued too soon. Criteria seemed to prevent "OD" not
	collision.
Case 4a, Cell 1.5.4.c, Arrival Chasing Taxi	SYS2, T3066 INJECT TEST1-0007@16:46:20
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	✓ Alarm went off and should have with only 2000' or so between a/c
Negatively No Effect Positively	✓ Mandatory go around is appropriate. ✓ Alert did not indicate possibility of collision.
1 2 5	✓ Go around would be appropriate. Alert was appropriate.
$1 \qquad \qquad 1 \qquad \qquad 2 \qquad 1$	
Case 4b, Cell 1.5.4.c, Arrival Chasing Taxi	SYS3, T8042214@22:13:30
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	Alarmed and shouldn't have. No collision imminent.
No Effect Docitively	✓ Mandatory go around is not appropriate- preceding a/c was
23 4	Alert did not indicate possibility of collision.
-	Vo slort chould have heen iscured

Case 4c, Cell 1.5.4.c, Arrival Chasing Taxi	1 Chasing Taxi		SYSI, <u>T4102128@21:27:45</u>
When following the Draft ATC AMASS Operational AMASS response affect your ability to nerform your		Procedures, how does the assigned duties?	Test team responses:
			V Did not alarm and should not have.
			No alarm
Negatively	No Effect	Positively 5	No pending collision.
	4	1	TO ATICK!
Case 4d, Cell 1.5.4.c, Arrival Chasing Taxi (Taxi	l Chasing Taxi (Taxi Xing ARR)	IRR)	SYS1, F4171628@16:2745
When following the Draft ATC AMASS Operational	C AMASS Operational Proce	Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your		assigned duties?	
			<ul> <li>Crossing traine was well clear and AMASS did not alarm.</li> <li>No alarm, not even close.</li> </ul>
Negatively	No Effect	Positively	V No alert, A/c clear.
1 2	3 4	S 9222222222	✓ No alert.
	ະດ		
Case 4e, Cell 1.5.4.c. Arrival	Case 4e. Cell 1.5.4.c. Arrival Chasing Taxi (Taxi Xing ARR)	R.R.)	SYS3, T42267@ 21:05:10
When following the Draft ATC AMASS Operational AMASS resonance affect your ability to nerform your	C AMASS Operational Proce	Procedures, how does the	Test team responses:
			Crossing traffic was no factor but triggered an alarm.
			Fix alert, Go around command is not appropriate. traffic
Negatively	No Effect	Positively	crossing was almost clear, no factor.
1 2	3 4	5	✓ Not an indication of a potential collission.
5			Alert too soon.
Case 4f, Cell 1.5.4.c, Arrival	Case 4f, Cell 1.5.4.c, Arrival Chasing Taxi (taxi Xing ARR)	$(\mathbf{R})$	SYS3 <u>T4226(a)21:05:10</u>
When following the Draft AT	When following the Draft ATC AMASS Operational Procedures, how does the	dures, how does the	Test team responses:
AMASS response affect your ability to perform your	ability to perform your assigne	assigned duties?	•
			No alarm, good.
Negatively	No Effect	Positively	No action required.
1 2	3 4	5	V No alert
		. 73	
Case 4g, Cell 1.5.4.c, Arrival Chasing Taxi	I Chasing Taxi		STL; SYS3, TSTL4225@ beginning
When following the Draft ATC AMASS Operational AMASS response affect your ability to perform your	ational n your	Procedures, how does the assigned duties?	Test team responses:
•			
Negatively	No Hffert	Docitively	Not tested.
146gaireiy		1 OSMIVELY	

SYS2, T3066 INJECT TEST1-0010 @ 16:46:30	Test team responses:	✓ Appropriate alert but too late. Open up TAIU. Don't want alert	on FOD. Need acceleration.	✓ Agree that alarm occurred in timely manner.	Alert Rx: Mandatory go around is appropriate.	/ Impending collision	✓ Alarm in this case was too late. A/c taking off needs to alarm	sooner. Alarm was needed.	SYS2, T3066 INJECT TEST1-0024 @ 16:46:30	Test team responses:	Appropriate alert, may not need whole runway hot.	Alarm occurred in a timely manner	✓ Alert Rx: Mandatory go around is appropriate.	✓ Possible collision.	✓ Alarm was appropriate.		SYS2, T3066 INJECT TEST1-0006@16:47:00	Test team responses:		✓ Agree with the alarm going off with jet on ½ mile final.	✓ Alert Rx: Mandatory go around appropriate (if an aircraft).	Note: These head-on examples are confusing- if the head-on	traffic is a vehicle, mandatory go around is/may not be	appropriate.	✓ Potential collision.	Alarm appropriate.	SYS2, T3066 INJECT TEST1-0023 @ 16:44:45	Test team responses:		Agree with the alarm going off with jet on 1/2 mile final	Note: These had on example on confining if the had on	Note: These mead-on examples are commusing- in the mead-on	traffic is a vehicle, mandatory go around is/may not be		V Fotential collision.
Case 5, Cell 1.5.1.d, Arrival Head-on with Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?			Negatively No Effect Positively	1 2 5	1 1 3		Case 6, Cell 1.5.2.d, Arrival Head-on with Aborted Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?			Negatively No Effect Positively	1 2 3 4 5	1 1 3	Case 7, Cell 1.5.3.d, Arrival Head-on with Lander	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?			Negatively No Effect Positively	5	1 2 2			Case 8a, Cell 1.5.4.d, Arrival Head-on with Taxi	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?		Namely No Effect	NO Ellect	3 5	2 1 2	

SYS2, T7211755@17:55:00			V Didn't alarm and shouldn't have.	V No afert received for this situation is a deal and close.	V No potential collision.	V No alarm, no alarm needed.		SYS2, T3066 INJECT TEST1-0025 @ 16:46:30	Test team responses:	<u> </u>	✓ Alarm went off at appropriate time.	No potential collision.				SYS2, T5215544@22:43:45		Test team responses.	V No slarm none needed	No alarm, routine scenario, anticipated separation (high speed	(axiwav)	No potential collision.	No alarm needed.	SYS2. T5211645@16:44:25		 ✓ Alarm went off when a collision did not seem imminent.	A caution was received, no action taken due to taxi was clearing.	✓ Did not indicate a potential for collision.	V No mandatory go around. Warning, but no collision potential.		SYS2, T3066 INJECT TEST1 0006@16:47:27	Test	✓ Good alarm	✓ Definite collision.	Warning given, no mandatory go around.	<b>&gt;</b>
Case 10, Cell 1.3.1.c, Lander Chasing Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AIWASS response affect your ability to perform your assigned duties?			No Effect	1 2 3 4 5	7	Case 11, Cell 1.3.2.c, Lander Chasing Aborted Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?			Negatively No Effect Positively	2	<b>)</b>	Case 12. Cell 1.3.3.c. Lander Chasing Lander	17	When following the Draft ATC AMASS Operational Procedures, now does the AMASS response affect your ability to perform your assigned duties?			Negatively No Effect Positively		4	Case 13. Cell 1.3.4.c. Lander Chasing Taxi	When following the Draft ATC AMASS Operational Procedures, how does the			Negatively No Effect Positively	1 3	1 3 1	Case 16, Cell 1.3.3.d, Lander Head-on with Lander	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?		3	Negatively No Effect Fositively 1 2 3 4 5

Test team responses:  Vould like an alarm when arrival is 1/4 mile final, not after becoming a lander because at that point it is too late.	Opposite direction needs more space. Aircraft in arrival state.  Vant go around with opposite taxi.	SYS2, T3066 INJECT TEST1-0023 @ 16:46:30  Test team responses:   Want go around with opposite taxi.  Would like an alarm when arrival is ¼ mile final, not after becoming a lander because at that point it is too late. Too late for me to do anything. Anytime dealing with opposite direction traffic	regardless of where taxi is on runway (we lose control at the point a/c is rolling out.  Alarm too late, ???? traffic needed alert when in arrival state.  Opposite direction needs more space. Aircraft in arrival state.	SYS2, 13066 INJECT LESTE 23 (a) 16:46:45  Test team responses:  Vant go around with opposite taxi.  Y Too late,  Alarm too late. ???? traffic needed alert when in arrival state.	Opposite direction needs more space. Aircraft in arrival state.  ✓ Opposite direction cell should have distance increased.	Test team responses:  V Want go around with opposite taxi.  Not sure.  Need to look at crossers vs opposite direction traffic.	
Procedures, how does the assigned duties?	Positively5	Procedures, how does the assigned duties?  Positively		Procedures, how does the assigned duties?	Positively5	Procedures, how does the assigned duties?	Positively 5
	No Effect 3 4	128.54 . W	t dist	24/2	No Effect		No Effect 3 4
Case 17a, Cell 1.3.4.d, Lander Head-on with Taxi When following the Draft ATC AMASS Operational AMASS response affect your ability to perform your	Negatively 12 2	Case 17b, Cell 1.3.4.d, Lander Head-on with Faxi When following the Draft ATC AMASS Operational AMASS response affect your ability to perform your Negatively		Case 17c, Cell 13, 4.d, Lander Head-on with 1 axi When following the Draft ATC AMASS Operational AMASS response affect your ability to perform your	Negatively 12	When following the Draft ATC AMASS Operational AMASS response affect your ability to perform your	Negatively 12

SYS2, T3066 INJECT TEST1-0021@16:46:45	Test team responses: <pre>           Timely alert.            Timely alert.            Alert received (warning)- but it is to be changed to a caution. (non mandatory alerts). No collision potential.            No collision potential            Alarm was appropriate. </pre>	SYS2, T3066 INJECT TEST1-0022@16:46:30  Test team responses:	SYS2, T5240200 @ 01:59:15  Test team responses:  V No alert, none needed.  No alerts, two rollers same runway  No alert, no collision potential.  No alert, no conflict	SYS2, T3066 INJECT TEST1-0013 @ 16:45:10  Test team responses:
Case 18a, Cell 1.3.6.b, Lander vs. Stopped	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  Positively	Case 18b, Cell 1.3.6.b, Lander vs. Stopped  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  Positively  1 1 1 1 1	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  No Effect  A 1	Case 19b, Cell 1.1.1.c, Departure Chasing Departure  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  Positively  1

SYS3, T8040457 @ 04:36:30	Test team responses:	V No alarm, not needed or wanted	<ul> <li>2???? departures(mu-2's) same runway</li> <li>Don't want this alert</li> </ul>	V No alarm		SYS3, T8040557 @ 05:56:00	Test team responses:   No alarm, none needed.	v Muniple Br.A departures 21/110 atariii  v no alert wanted	✓ no alarms		SYS2, T3066 INJECT TEST1:0014 @ 16:45:00	Test team responses:	Varning alert- is appropriate	/ alert.	✓ Alarm was appropriate.		SYS2, T5241854@18:54:25	Test team responses:	<ul> <li>truck on runway 26R- after an arrival/lander</li> <li>No alert</li> </ul>	<b>&gt;</b> >	
Case 19c. Cell L.J.L.c. Departure Chasing Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?		Negatively No Effect Positively	3	Case 19d, Cell 1.1.1.c, Departure Chasing Departure	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?		Negatively No Effect Positively	1 3	Case 20, Cell 1.1.2.c, Departure Chasing Aborted Departure	When following the Draft ATC AMASS Operational Procedures, how does the	AiviAoo response affect your ability to perioriff your assigned duties?		No Effect	1 2 2	Case 21a, Cell 1.1.3.c. Departure Chasing Lander	When following the Draft ATC AMASS Operational Procedures, how does the	AMASS response affect your ability to perform your assigned duties?	Negatively No Effect Positively	

SYS2, T3066 INJECT TEST1-0012@16:47:00	Test team responses:	SYS2, T5241854 @ 18:54:25  Test team responses:	SYS2, T3066 INJECT TEST1-0016 @ 16:47:00  Test team responses:	SYS2, T3066 INJECT TEST1-0019 @ 16:46:40  Test team responses:
Case 21b, Cell 1.1.3.c, Departure Chasing Lander	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  Positively  1 1 2	Case 22, Cell 1.1.4.c, Departure Chasing Taxi When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively No Effect No Effect 1	Case 23, Cell 1.1.1.d, Departure head-on with Departure When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively Negatively No Effect 1 1 1 1 1	Case 24, Cell 1.1.2.d, Departure head-on with Aborted Departure When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively No Effect No Effect 1 1 1 1 1 1

SYS2, T3066 INJECT TEST1-0020 @ 16:47:00	Test team responses: <ul> <li>Timely alert</li> <li>Timely alarm</li> <li>Alarm is appropriate</li> </ul>	SYS2, T3066 INJECT FESTI-0017 @ 16:47:00  Test team responses:	SYS2, T3066 INJECT TEST1-0018 @ 16:47:00  Test team responses:	SYS2, T3066 @ 16:46:50, note: CLOSE RUNWAY!  Test team responses:
Case 25, Cell 1.1.3.d, Departure head-on with Lander	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  1 1 1 1	Case 26, Cell 1.1.4.d, Departure head-on with Taxi  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  1 1 1 1	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  No Effect  Positively  1 1 1 1	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  No Effect  Sammer Amazon Procedures, how does the AMASS response affect your ability to perform your assigned duties?

Case 29, Rain front in Atlanta	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
Negatively No Effect Positively 1	Not tested.
Case 30, Rain Front in San Francisco When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	SYS4, note: uses AMASS and ODU  Test team responses:
Negatively No Effect Positively 1	Not tested.
Case 31. taxi under departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  Target crossing under departure alarm did not recognizea/c departure was airborne and did not provide any alarm until too
Negatively No Effect Positively 1 2	late to react.
Case 32, Vehicle on edge of runway	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  V Don't want an alarm for vehicles just off the side of the runway.  Alarm alerted- appropriate- have time to analyze truck on side of
Negatively No Effect Positively 1 2	runway- cneck map  Do not want alert- need to review ASDE mapping.  Vehicle on edge of runway- alarmed with vehicle next to runway.

## APPENDIX F AT OT, OET MOP/MAOR Result Matrix

Test Result Matrix for ATO-2, OET.

Test Date(s):8/9/99 to 8/13/99

Test Lead: Jeff Livings

Test Engineer: Chuck Dudas

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-1.27: Source: ORD 3.r.(5).\$2	MAOR-1.27.1: AMASS PoD and False detection	PASS			
Neither target detection	rates must not be affected fair weather,				
shall be degraded in	and snow conditions.				
weather conditions	MAOR-1.27.2: As determined by test team				
coverage area including	consensus, AMASS false				
fair weather, rain levels					
up to and including to nm/hour; and snow	wearner, rain and snow conditions are suitable				
conditions.	for AMASS operations.				
MOP-1.31:	MAOR-1.31: As determined	PASS			
Source: Derived from COI-	a)				
-1	support AT operations				
Does the AMASS provide	are turned on and				
controllers with suitable	provide suitable				
alerts?	coverage (parameters)				
	ior ail required airport confiqurations.				
MOP-2.2:	MAOR-2.2.1: Each	PASS			
Source: ORD 3.a.(1).\$2	operational runway must				
A unique AMASS data base	base configuration.				
configuration shall be	MAOR-2.2.2: As				
created and available for	determined by test team				
use for each of the	consensus, AMASS				
operational runway	provides for the				
employed at the adapted	of an adapted airports				
airport.	operational			•	
	configurations.				
MOP-2.14:	MAOR-2.14: As determined	PASS			
Source: Derived from COI-	by test team consensus,				
7	the AMASS Taise alert	-			
Do the AMASS adaptation	affect airbort				
capabilities allow for a	operations or the				
false alerts rate	controllers ability to				
suitable for performing the AMASS mission?	periorm the assigned duties.				

MOD-2 15.	MACR-2 15. As determined	DAGG	
Source: Derived from COI-	by test team consensus,		
2	the AMASS nuisance alert		
	rate does not adversely		
	affect airport		
capabilities allow for a			
nuisance alert rate	controllers ability to		
sultable for performing	perform the assigned		
MOD-3 35.	MACRES 35 1. Alert	DACC	
Source: ORD 3.d.(3).(c).3	messages must contain	2	-
	abbreviations as		
	furnished by Air		
Displayed alerts shall	Traffic.		
contain abbreviations for			
words furnished by Air	MAOR-3.35.2: As		
Traffic.	determined by test team		
	consensus, the AMASS		
	provided displayed alert		
	messages are suitable		
	for AMASS operations.		-
	4		-
MOP-3.83:	MAOR-3.83: As determined		
Source: Derived from COI-	by test team consensus,		
m	the display presentation		
	of AMASS is suitable for		
Is the display	performing the AMASS		
presentation of AMASS	mission (i.e.,		
suitable to perform the	implemented government		
AMASS mission?	provided list of text		•
	messages, font size		
	icons, filter icons,		
	alert icons, closed	•	
	runway indicator, TA		
	indicator and system		
	status).	PASS	
MOP-3.84:	MAOR-3.84. As determined		
Source: Derived from COI-	by test team consensus,		•
3	the government provided		
	list of aural messages		
Is the aural presentation	is suitable for		
of AMASS alerts suitable	performing the AMASS		
to perform the AMASS	mission (tone, diction,		
mission?	speed, message content).	PASS	

### APPENDIX G

AT OT, OUT Sub-Test Questionnaires (July 1999)

Questionnaire for ATO-2, OUT.

	OUT, Training	Questionnaire ATO-2,OUT, Training and Documentation	tion		Composite Results	Kesults		
AMASS Menu Mode	Enter AMASS Mode	Go to the Utilities Menu	Select an AMASS auport	Close/Open runways	Gato AMASS TEL	Move AMASS Alerts Window	Go to, ASDE Main.	Display AMASS Function Key Summary
Q1: AT User's Manual	OK- 4	0K-4	OK-4	OK-4	OK-4	OK-4	OK-3	OK-4
Was the command found T	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard
	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found-1	Not Found
Q2: AT User's Manual Entry	OK- 4	OK- 4	OK- 4	OK- 4	OK-4	OK- 4	OK- 3	OK-3
Was the command's entry Useful/complete enough?	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic
	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete-1	Incomplete-1
Q5: Training	Emphasize-2	Emphasize-2	Emphasize-3	Emphasize-3	Emphasize-2	Emphasize-2	Emphasize-3	Emphasize-3
To what extent should the I	Include-2	Include-2	Include-1	Include-1	Include-2	Include-2	Include-1	Include-1
<del></del>	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize
****** Comments ******  Place in the appropriate command column the Q# before each comment.	V User's Manual is fine V Selling the AMASS po V Operational training w V Manual appears well-v V Manual is too bulky fo V The AT Users manula V The AT User Manual more "user friendly".	User's Manual is fine for training rooms, however operationally veling the AMASS program would be easier with a 15-minute visoperational training will take less than 15-minutes.  Manual appears well-written and information is readily available. Manual is too bulky for day-to-day operations. A cheat card with The AT Users manula assumes that the user is already "ASDE-3 In the AT User Manual will be cumbersome to the controller and not more "user friendly".	ining rooms, how a would be easier e less than 15-mi and information to-day operation tes that the user i cumbersome to	for training rooms, however operationally we need quick-rogram would be easier with a 15-minute video explaining ill take less than 15-minutes.  written and information is readily available.  r day-to-day operations. A cheat card with all the most like assumes that the user is already "ASDE-3 Entry" friendly, will be cumbersome to the controller and not well received.	ly we need quicle video explaininble. ble. idh all the most lesty friend do not well receive	User's Manual is fine for training rooms, however operationally we need quick-reference cards which define entires. Selling the AMASS program would be easier with a 15-minute video explaining what it does and doesn't do. Operational training will take less than 15-minutes.  Manual appears well-written and information is readily available.  Manual is too bulky for day-to-day operations. A cheat card with all the most likely items a controller would need.  The AT Users manula assumes that the user is already "ASDE-3 Entry" friendly.  The AT User Manual will be cumbersome to the controller and not well received. A condensed/Quick reference Card would be more "user friendly".	hich define entire doesn't do. bller would need. Juick reference C	ard would be

Questionnaire ATO-2,OUT, Training and Documentation	2,OUT, Traini	ng and Docum	entation		Соп	Composite results	S			
AMASS Keyboard Coningads:	Möve AMASS Alert window	Return to ASDE Functions	Display the AMASS Function Key Summary	Filer all alerts on ground track	Filter caution akerts on ground tracks	Enable all alens on ground tracks	Filter arrival alerts	Enable Arrival	Extend Alert Timeout Period Stopped frack	Restore Alert Timeout Period Stopped track
Q1: AT User's Manual	OK-3	OK-2	OK-3	ОК-3	OK-3	OK-3	OK-3	OK-3	OK-3	OK-3
Was the command found easily enough?	Too Hard	Too Hard-1	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard
	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found
Q2: AT User's Manual Entry	OK	ОК	ОК	OK	ОК	ОК	ОК	ОК	ОК	ОК
Was the command's entry useful/complete enough?	Too Cryptic-3	Too Cryptic-3	Too Cryptic-2	Too Cryptic-3	Too Cryptic-2	Too Cryptic-3	Too Cryptic-3	Too Cryptic-3	Too Cryptic-3	Too Cryptic-3
	Incomplete	Incomplete	Incomplete-1	Incomplete	Incomplete-1	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete
Q5: Training	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize
To what extent should the AMASS AT Training cover	Include	Include	Include	Include	Include	Include	Include	Include	Include	Include
each listed command?	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize
***** Comments *****	✓ This war There is	This was acceptable during lab/class- As I was able to take the time to read and make entries- But in a control tower atmosphere. There is not enough time to look at the manual	ing lab/class- A e to look at the	s I was able to manual	take the time	to read and n	ıake entries- E	But in a contro	ol tower atmo	sphere-
Place in the appropriate command column the Q# before each comment.									,	

Questionnaire ATO-2,OUT, Training and Docu	2,OUT, Traini	ing and Docum	mentation		Con	Composite Results	ts			
AMASS Keypad Cournands	Move AMASS Aker window	Return to ASDE. Punctions	Display the AMASS Function Key Summary	Filer all sterts . On ground track	Fifer caution raters on the ground tracks	Enable all alerty on ground tracks	e Filor arrival alerts	Enable Arrival Alerts	Extend Alert Timeout: Period Stopped Track	Restore Alert Timeout Period Stopped track
Q1: AT User's Manual	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4
Was the command found easily enough?	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard
	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found	Not Found
Q2: AT User's Manual Entry	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4	OK-4
Was the command's entry useful/complete enough?	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic
	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete	Incomplete
Q5: Training	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Emphasize	Enphasize	Emphasize
To what extent should the AMASS AT Training cover	Include-4	Include-4	Include-4	Include-4	Include-4	Include-4	Include-4	Include-4	Include-4	Include
each listed command?	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize	De-emphasize
***** Comments *****	✓ Same as	Same as Menu's, All inf	info is available but most controllers will never bother to open the manual. Need a cheat sheet.	ut most contro	llers will neve	r bother to op	en the manua	l. Need a chea	ıt sheet.	
Place in the appropriate command column the Q# before each comment.										

### APPENDIX H AT OT, OUT MOP/MOAR Result Matrix

Test Results Matrix or ATO-2, OUT.

Test Date(s):8/9/9 to 8/13/99

Test Lead: Jeff Livings

Test Engineer: Chuck Dudas

MOP	MAOR	PASS/ FAIL	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP-3.83:	MAOR-3.83: As determined by test	NOT	Human Factors Report		
Source: Derived from COI-3	team consensus, the display presentation of AMASS is suitable	TESTED			
Is the display presentation of AMASS for performing the AMASS mission	for performing the AMASS mission				
suitable to perform the AMASS	(i.e., implemented government				
mission?	provided list of text messages, font				
	size track icons, multi-path icons,				
	filter icons, alert icons, closed				
	runway indicator, TA indicator and				
	system status).				
MOP-3.85:	MAOR-3.85. As determined by test	PASS			
Source: Derived from COI-3	team consensus, the operational				
	control provided by AMASS are				
Does AMASS provide suitable	suitable for performing the AMASS				
controls to operationally control the	mission (Selecting AMASS				
system?	configuration, closing runways,				
	volume adjustment, placement of				
	alert text box and hot keys).				
MOS-4.45:	MAOR-4.45: As determined by test	TESTED			
Source: Derived from COI-4	team consensus, the AMASS	IN ATO-1			
	inhibit/re-inhibit functions suitably				
Does the inhibit/re-inhibit functions	support AT Operations (i.e.,				
of AMASS suitably support the	available filters, filter controls, filter				
AIVIAGO IIIISSIOII :	display and inter status).				

#### APPENDIX I

AT OT, OET Sub-Test Questionnaires at ATL (July 1999)

Summary of test team responses to the ATO-3, OET questionnaire	
Case 1a, Cell 1.5.1 c. Arrival Chasing a Departure	
Procedures, how does the issigned duties?	Test team responses:
	Alerted, arrival not a potential for go around No alarm needed, too much separation
No Effect F	
15	
Case 1b, Cell 1.5.1.c. Arrival Chasing a Departure	
Procedures, how does the ssigned duties?	Test team responses:
	No potential for collision, go around would create unwarranted situation
No Effect F	
15	
Case Ic, Cell 1.5.1.c, Arrival Chasing a Departure	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
marron response arrest year actively to perform year assigned dances.	No collision potential
	Mandatory go around with almost 4700' in front of departure
No Effect	Alert terminated quickly, difficult to analyze the situation. Alert
3 2	Degain in piency of unite nowever. Manuatory go around not necessary in this cell
	Time of alert sufficient for GA. Possibly could have landed.
arture	
w does the	l est team responses:
AMASS response affect your ability to perform your assigned duties?	Warning appropriate  Timely alert
	Alarmed at 2/3 mile.
Negatively No Effect Positively	Procedure is appropriate, AMASS reacted in adequate time to
3	Air of milyenaing struction.  Aircraft to far out to issue go around. Could have gotten aborted
	a/c off the runway. If not watching this, the alert would have been effective to warn of an impending situation.

	Test team responses:	✓ Time of alert sufficient to issue go around. Could have come in ¼	mile but still would have sent around. Traffic on runway.	✓ The situation is variable and dependant on the speed of first a/c. I	can see in some situations where an a/c will be clear of the	runway but AMASS still alarms and causes a go around.	✓ Warning with an arrival and a lander	✓ Don't want alert	✓ Alert appropriate/could go either way/		Test team responses:	✓ Both a/c slow enough to issue any instructions. Deal has happened	but no action taken.	✓ Not enough reaction time available.	✓ Alarmed with slow a/c or vehicle on runway	✓ Tight but good alert	✓ alert appropriate		Test team responses:	✓ Both a/c slow enough to issue any instructions. Deal has happened	but no action taken.	As an arrival there was insufficent time to take action according	to the procedures	✓ Good alert	✓ Alert appropriate	<i>&gt;</i>		Test team responses:	alarm was adequate to bring your attention to an imminient situation too early for a mandatory as around	Appropriate alert		
	Procedures, how does the	assigned duties?			Positively	. 45	ю				Procedures, how does the	assigned duties?			Positively	- 4 5	1 1		Procedures, how does the	assigned duties?			Positively	- 45	1			Procedures, how does the	assigned duties?		Positively	- 4 1
Case 3, Cell 1.5.3.c, Arrival Chasing Lander	When following the Draft ATC AMASS Operational	AMASS response affect your ability to perform your assigned duties?			No Effect	. 23	2			rrival Chasing Taxi	When following the Draft ATC AMASS Operational	AMASS response affect your ability to perform your assigned duties?			No Effect	2 3	7	Arrival Chasing Taxi	When following the Draft ATC AMASS Operational	AMASS response affect your ability to perform your assigned duties?			No Effect	. 23	က		rrival Chasing Taxi	When following the Draft ATC AMASS Operational	AMASS response affect your ability to perform your assigned duties?		No Effect	21
Case 3, Cell 1.5.3.c, Ar	When following the Dra	AMASS response affect			Negatively		1			Case 4a, Cell 1.5.4.c, Arrival Chasing Taxi	When following the Dra	AMASS response affect	•		Negatively		-	Case 4b, Cell 1.5.4.c, Arrival Chasing Taxi	When following the Dra	AMASS response affect			Negatively	1 2 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3			Case 4c, Cell 1.5.4.c, Arrival Chasing Taxi	When following the Dra	AMASS response affec		Negatively	

Positively  4	KIN OF	
Positively  Test how does the Test huties?  Positively  Positively  Positively  Positively  Positively  Positively  Positively  Positively  Positively  S  Positively  Positively  S  A  Positively  A	When following the Draft ATC AMASS Operational Procedures, now does the AMASS response affect your ability to perform your assigned duties?	<ul> <li>lest team responses:</li> <li>Appropriate alert</li> <li>Too late to take evasive action. Came out at R11 conflicting with lander- possibly 2000' maximum.</li> </ul>
es, how does the Test Positively Carlo Car	No Effect 3 4	
res, how does the Test huties?  Positively '  res, how does the Test huties?  Positively '	Case 4e. Cell 1.54.c. Arrival Chasing Taxi (Taxi Xing ARR)	
Positively  ses, how does the  Positively  Positively  ses, how does the  Positively  Positively  Ses, how does the  Positively  Positively  Positively  Positively  Positively  Positively  Positively  Positively	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  ✓ 2 a/c would have hit
Positively - 5 - 2 - 5 - 2 - 5 - 5 - 5 - 5 - 5 - 5		v no alert, good result v .no alert
es, how does the Test duties?  Positively  ses, how does the Test duties?  Positively  Positively  Positively  Positively  Positively	No Effect	no alert/ crossed-but in time- acceptable parameters
es, how does the Test thities?  Positively  cs, how does the Test thities?  Positively  Positively  Positively  Positively  Positively		
assigned duties?  Positively  1 2   Procedures, how does the Test assigned duties?  Positively  4  -4	ase 4f. Cell 1.5.4.c, Arrival Chasing Laxi (taxi-Xing Arxi).  When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
Positively  1 2 4  1 2	AMASS response affect your ability to perform your assigned duties?	✓ Which do you do, Do you issue a go around on the a/c when arriva?
Positively  1 2 2  Procedures, how does the assigned duties?  Positively  A5		✓ Would have been barely legal. But go around would have been
Procedures, how does the Test assigned duties?  Positively  4	No Effect	unnecessary
Procedures, how does the Test assigned duties?  Positively  A  Test	1	<ul> <li>Appeared as wrning then caution but still in time to sellu around.</li> <li>Need to project clearing</li> </ul>
Procedures, how does the Test assigned duties?  Positively  4	ase do Cell 1.5.4 c. Arrival Chasino Taxi	
ositively	ા જ	Test team responses:
No Effect Positively   1 4 4   No Effect A		<ul> <li>Too late to go around</li> <li>Advisory would be appropriate</li> </ul>
· · · · ·	No Effect	V Too late
· <b>&gt;</b>	4	Good, not applicable to 3000° rule.      Timely
	T T	Appropriate alert.

When following the Drift ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively Negatively Negatively Negatively Negatively Negatively Negatively Negatively No Effect No Effe	Case 5. Cell 1.5.1.d. Arrival Head-on with Departure	
Positively  4 2 2  1 Departure  Procedures, how does the Test assigned duties?  4	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  Time of alert sufficient for Go around. Could have come in 1/8
Procedures, how does the assigned duties?  Procedures, how does the rest assigned duties?	No Effect	mile.  A little earlier alert would have benn helpful Too late to send around arrival Good
Procedures, how does the Test Procedures, how does the Test 1 1	. 4	<ul> <li>Timely</li> <li>Appropriate if a/c, if truck, no mandatory go around needed.</li> </ul>
Positively  1 1 1 1 Frocedures, how does the assigned duties?  1 1 1 Fositively  4  Procedures, how does the Test assigned duties?  Procedures, how does the Test assigned duties?  2	r3	Test team responses:  Time of alert sufficient for Go around. Could have come in 1/8
Procedures, how does the Test assigned duties?  1	No Effect	mile.  Enough time to take action  2/3 to 3/4 mile alarmed. Good alarm with warning
Procedures, how does the Test assigned duties?  Positively  1  1  Procedures, how does the Test assigned duties?  Procedures, how does the Test 2  A	1	<ul> <li>Not sure if a want mandatory action</li> <li>Appropriate if a/c, if truck, no mandatory go around needed.</li> </ul>
Procedures, how does the Test assigned duties?  Positively  1  Procedures, how does the Test assigned duties?  Procedures, how does the Test assigned duties?  2	Case 7, Cell 1.5.3.d, Arrival Head-on with Lander	
ositively  v does the  v ositively  s ositively  c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively c ositively	_ G	Test team responses:  Time of alert sufficient for Go around. Could have come in 1/8
w does the Test  v ositively  2	No Effect	<ul> <li>mile.</li> <li>If this was planned, a go around would be inappropriate</li> <li>Good alarm w/ a/c., If vehicle, could get it of runway.</li> </ul>
w does the Test		<ul> <li>Timely</li> <li>Go around appropriate- although lander did exit runway on high speed (so go around was not needed)</li> </ul>
w does the Test  solutively  2	Case 8a, Cell 1.5.4.d, Arrival Head-on with Taxi	
No Effect Positively 1 2	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  Time of alert sufficient for Go around. Could have come in 1/8 mile
<b>&gt;&gt;</b>	No Effect 3 4	<ul> <li>Appropriate alert</li> <li>Alarm too late if on a/c.</li> <li>Collision</li> </ul>
	1 1 2	Timely Very appropriate

Test team responses:  'Time of alert sufficient for Go around. Could have come in 1/8 mile 'Go around required and appropriate 'Good alarm 'Collision 'Timely 'Very appropriate	Test team responses:      Time of alert sufficient for go around     Unable to issue go around in time     Good alarm again     Don't think I could have sent him around in time     Good alert, but if target had been moving it would've been too soon     Go around would be spooky, not enough time.	Test team responses:      Arrival could have come in a lot closer     Alarmed at 2/3 mile     Good alert, but if target had been moving it would've been too soon     appropriate     text box in the way. Timing seemed better     text box in the way. Timing seemed better     timely, but possibly not needed     timely, but possibly not needed     Too early, plenty of time to maneuver
Case 8b Cell 1.5.4.d, Arrival Head-on with Taxi When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively No Effect Positively 1	Case 9a, Cell 1.5.6.b, Arrival vs. Stopped Target  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  Negatively  No Effect  Positively  1	Case 9b, Cell 1.5.6.b, Arrival vs. Stopped Target  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  1

Case 10, Cell 1.3.1.c, Lander Chasing Departure	「「「「「「「「」」」というという。 こうかん こうかん こうきん かいき かいかい こうかい できない もの はいけい ないない ないない ないない ないしゅう こうかん 自動を引き込む しゅうしょう しょうしょう しょうしょう しゅうしょ しょうしょ しょうしょう しょうしょく しょくしょく しょうしょく しょくしょく しゃくしょく しょくしょく しょく
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  V Nuisance alarm  V Caution not needed.
Negatively         No Effect         Positively           1         3         3	
Case 11, Cell 1.3.2.c, Lander Chasing Aborted Departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  V Nuisance alert, 2 a/c were not going to hit.
	<ul> <li>Alert was ok, except a/c was almost clear of runway.</li> <li>Too early</li> </ul>
No Effect	V Don't want alert, traffic was clearing
2 2 2 3	<ul> <li>Too early</li> <li>Not appropriate</li> </ul>
Case 12, Cell 1.3.3.c, Lander Chasing Lander	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	<ul> <li>Alert was only moderately useful, collission did not appear as a factor</li> </ul>
;	V Good alarm
Negatively No Effect Positively 1 2 3 4	✓ Don't want alert, incursion only. ✓ Timely
1 2 2	V Not appropriate, no chance for collision
Case 13, Cell 1.3.4.c, Lander Chasing Taxi	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  Valid alert, taxi was slower  Alert, no mandatory action
Negatively No Effect Positively	<ul><li>Timely</li><li>Appropriate alert</li></ul>
1 3 5	
Case 16, Cell 1.3.3.d, Lander Head-on with Lander	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  ✓ Good alarm  ✓ Alarm was appropriate but not much time to do anything
Negatively No Effect Positively 1 2 3 4	

Case 17a. Cell 1.3.4.d. Lander Head-on with Taxi	以 1000 1000 1000 1000 1000 1000 1000 10
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  Y Too late for go around  V Little late on alarm  Y Too late
Negatively No Effect Positively 1 2 3 4 5	`
Case 17b, Cell 1.3,4.d, Lander Head-on with Taxi When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
Negatively No Effect Positively 1 3 4	
Case 17c, Cell 1.3.4.d, Lander Head-on with Taxi When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
Negatively No Effect Positively 1	
Case 17d, Cell 1.3.4.d, Lander Head-on with Taxi When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
Negatively No Effect Positively 1	

	Test team responses:  Alert in sufficient time to issue traffic  Good alarm  Timely alarm.			Test team responses:  Sufficient time to issue go around  Good alarm			Test team responses:				Test team responses:  Second departure could have been aborted to avoid collision  Can't see any use for this.	✓ Good alarm ✓ Close but no collision threat.
	nal Procedures, how does the our assigned duties?	Positively 4 5		nal Procedures, how does the nur assigned duties?	Positively 4 5	rture	nal Procedures, how does the our assigned duties?	Positively		ırture	nal Procedures, how does the our assigned duties?	Positively 5
Case 18a, Cell 1.3.6.b, Lander vs. Stopped	When following the Draft ATC AMASS Operational Procedures, how AMASS response affect your ability to perform your assigned duties?	No Effect 2 3	Case 18b, Cell 1.3.6.b, Lander vs. Stopped	When following the Draft ATC AMASS Operational Procedures, how AMASS response affect your ability to perform your assigned duties?	No Effect 3	Case 19a, Cell 1.1.1.c, Departure Chasing Departure	When following the Draft ATC AMASS Operational Procedures, how AMASS response affect your ability to perform your assigned duties?	No Effect		Case 19b, Cell 1.1.1.c, Departure Chasing Departur	When following the Draft ATC AMASS Operational Procedures, how AMASS response affect your ability to perform your assigned duties?	No Effect 3 1
Case 18a, Cell 1.3.	When following the AMASS response a	Negatively 1	Case 18b, Cell 1.3.	When following the AMASS response a	Negatively l	Case 19a, Cell 1.1.	When following the AMASS response a	Negatively	1	Case 19b, Cell 1.1.	When following the AMASS response a	Negatively 1

Case 19¢. Cell I.1.c. Departure Chasing Departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	Not tested
Negatively No Effect Positively 1 2 3 4 5	
Case 19d, Cell 1.1.1.c, Departure Chasing Departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	not tested
Negatively No Effect Positively 1 2 3 4	
Case 29, Cell 1.1.2.c, Departure Chasing Aborted Departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  ✓ If not watching this, the alert would have been effective to warn
	of impending situation.  V Useful and appropriate
Ь	Cood alarm.
	<ul> <li>Good alert</li> <li>Appropriate.</li> </ul>
Case 21a, Cell 17.13.c, Departure Chasing Lander	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:  ✓ If not watching this, the alert would have been effective to warn
	of impending situation.
No Effect	Cood alarm
3 1	V Not a collision potential, could be a nuisance

Case 21b, Cell 1.1.3.c. Departure Chasing Lander	を行うに対している。 (1995年) 1900年間の最初のできた。 (1997年) 1900年 (1997年)
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
a	✓ If not watching this, the alert would have been effective to warn
	of impending situation.
	✓ Distance between targets did not indicate imminent collision.
Negatively No Effect Positively	✓ Good alarm
1 4 5	V Nuisance, no collision potential
2 1 1	✓ No collision potential
Case 22, Cell 1.1.4.c, Departure Chasing Taxi	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	✓ If not watching this, the alert would have been effective to warn
	or unperioring struction.  ✓ Good alert, collision may/may not have been potential.
Negatively No Effect Positively	✓ Good alarm
1 3 5	✓ Borderline nuisance, possible collision.
3 1	
Case 23, Cell 1.1.1.d, Departure head-on with Departure	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	Sufficient time to cancel clearance.
	V Useful, but rare.
Managine).	Cood alarm
A	Coout afet t
2	✓ Alert appropriate
Case 24, Cell 1.1.2.d, Departure head-on with Aborted Departure	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	✓ Sufficient time to cancel clearance.
	V Useful but rare.
	/ Timely, Good alert
Negatively No Effect Positively 1 2 3 4 5	✓ Timely alarm ✓ Appropriate alarm
2 3	

Test team responses:   Sufficient time to cancel clearance.  Need to issue abort instruction  Good alarm	<ul> <li>Need earlier alert to facilitate abort</li> <li>Appropriate alert, a bit early</li> </ul>	Test team responses:   Sufficient time to cancel clearance.  Very useful and appropriate  Good alarm  A Could abort take-off  Appropriate	Test team responses:   Sufficient time to cancel clearance.  Alert is useful  Good alarm  Need earlier alert to facilitate abort.  Appropriate alert but a bit early.	Test team responses: <ul> <li>Good alarm</li> <li>Good alarm</li> </ul> <li>This alarm could be moved out possibly for a more timely alert</li>
in Lander ttional Procedures, h 1 your assigned duties	Negatively No Effect Positively 1 2 3 4 5 1	When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  No Effect  2  3	Case 27, Cell 1.1.6.b. Departure vs. Stopped When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively Negatively No Effect Positively 1	Case 28, Cell 19:2:5.a, Arrival to Closed Runway  When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?  Negatively  No Effect  No Effect  No Effect  No Effect  2

Case 29, Crossing taxi with departure	
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
-	No action required, but if not watching the alert would have been effective
Negatively No Effect Positively	✓ Too late
1 2 5	✓ Alarm not needed, a/c was clearing
3 1	Alerted after traffic was in the air
	✓ A/c airborne, no conflict ✓ .
Case 30, Crossing taxi with departure	SYS4, note: uses AMASS and ODU
When following the Draft ATC AMASS Operational Procedures, how does the AMASS response affect your ability to perform your assigned duties?	Test team responses:
	No action required, but if not watching the alert would have been effective
Negatively No Effect Positively 1 2	<ul> <li>Too late to be useful</li> <li>No need for caution.</li> </ul>
	Alerted after traffic in air     Aircraft airhorne
	Not tested
Case 31, taxi under departure	
When following the Draft ATC AMASS Operational Procedures, how does the	Test team responses:
AMASS response affect your ability to perform your assigned duties?	<ul> <li>Target crossing under departure alarm did not recognize departure was airborne and did not provide any alarm until too</li> </ul>
	late to react.
Negatively No Effect Positively	`
1 1	

### APPENDIX J

AT OT, OUT Sub-Test Questionnaires at ATL (July 1999)

Questionnaire for ATO-3, OUT.

Questionnaire ATO-3,OUT, Select Airport Configurations	nfigurations	
Please answer the following questions for the "Select Auport. Configuration" function: Fr.	Chele your answer and inch	Circle your answer and include any comments in the blank space
Q1: AT User's Manual	OK -5	Manual is very wordy
Was the function found easily enough?	Too Hard-1	Table of Contents was used. Index would be better, Quick-reference card even better. Too many blank pages.
	Not Found	STILL don't want to dig thru the manual. Need a cheat sheet.
Q2: AT User's Manual Entry	OK-4	Easier to do this hands-on.
Was the function's entry useful/complete enough?	Too Crytic 2	Too wordy
	Incomplete	
Q3: Keystrokes	Good	Too much heads down time. Too many keystrokes.
Are the function's keystrokes acceptable?	Usable-5	But will be better with template.
	Unacceptable-1	
Q4: Feedback	Ok-4	Some messages were not understandable.
Was the function's feedback acceptable?	Not Useful-1	
	Not Needed	
Q5: Training	Emphasize-2	Important everday function.
To what extent should AMASS AT Training cover this subject?	Include-4	
	De-emphasize	
Q6: Command Selection	Yes-5	Tab/arrow keys are not used enough. Selection of keys should be more intuitive. Minipad is a bit better.
Does the function work as you require/prefer?	No-1	

Questionnaire ATO-3,OUT, Closing/Opening Runways	lunways	
Please answer the following questions for Closing (Opening Runways	Circle your answer and in	Circle your answer and include any comments in the blank space.
Q1: AT User's Manual	OK 4	Manual is very wordy.
Was the function found easily enough?	Too Hard-1	Table of contents used, but 2 possibilities exist
	Not Found	Want a cheat sheet.
Q2: AT User's Manual Entry	OK -3	Too wordy
Was the function's entry useful/complete enough?	Too Cryptic-2	Want a cheat sheet.
	Incomplete	
Q3: Keystrokes	Good-2	Too much heads down time.
Are the function's keystrokes acceptable?	Usable-1	Keypads did not always work. Keys stuck.
	Unacceptable-2	Want a cheat sheet
Q4: Feedback	Ok-2	Some was useful, some was confusing.
Was the function's feedback acceptable?	Not Useful-2	Want a cheat sheet.
	Not Needed	
Q5: Training	Emphasize-3	Also everyday functions.
To what extent should AMASS AT Training cover this subject?	Include-2	Want a cheat sheet
	De-emphasize	
Q6: Command Selection	Yes-3	Too easy to get lost in other functions. Hot keys needed.
Does the function work as you require/prefer?	No-2	

Questionnaire ATO-3,OUT, Setting the Alert Speaker Volume	Speaker Volume	
Please answer the following questions for Setting the Alert Speaker Volume	Circle your answer and inclu	Chole your answer and include any comments in the blank space
Q1: AT User's Manual	OK	No info in usets manual
Was the function found easily enough?	Too Hard	
	Not Found-5	
Q2: AT User's Manual Entry	OK	Same as above
Was the function's entry useful/complete enough?	Too Cryptic	Not in there
	Incomplete-2	
Q3: Keystrokes	Good-1	Turn knobs up or down, Turn unit off
Are the function's keystrokes acceptable?	Usable	
	Unacceptable	
Q4: Feedback	Ok ~	There is no feedback as to how the volume is set.
Was the function's feedback acceptable?	Not Useful-2	
	Not Needed	
Q5: Training	Emphasize	نئنذ
To what extent should AMASS AT Training cover this subject?	Include-1	
	De-emphasize	
Q6: Command Selection	Yes	No way to test volume of alert unless alert goes off. Position of amp in tower will probably be inaccessable to adjust volume. What are 2 channels for? What hanners when the nower is turned off?
Does the function work as you require/prefer?	No-6	

### APPENDIX K

AT Regression Questionnaire Test Responses (June 2000)

# AT- REGRESSION QUESTIONNAIRE RESPONSES USER INTERFACE TEST RESULTS

Questionnaire At-Ont-5, Ott, Set the Aight Speaker volume	Answer	Comments
O1: AT User's Manual	0k	The user's manual as an operational tool is of very
,	Too Hard	limited use. Quick reference cards at the Mini DCU are
Was the function found easily enough?	Not-Found 0	the best option for the ops quarters.
Q2: AT User's Manual	Ok	Same as above.
	Too Cryptic	
Was the function's entry useful/complete enough?	Incomplete 0	
Q3: Keystrokes	Good 2	
	Useable	
Are the function's keystrokes acceptable?	Unacceptable 0	
Q4: Feedback	Ok 3	After trying, the volume setting a couple of times – an
	Not Useful	acceptable level was reached.
Was the function's feedback acceptable?	Not Needed 0	
Q5: Training	Yes 3	Seemed Simple - Hotkey, Enter.
	O. S. S. S. O.N.	
Did AMASS AT Training sufficiently cover this subject?	N/A 0	
Q6: AT Operational Procedures	Yes 3	
	O. C. C. O.C.	
Does the AMASS provide the commands and controls necessary to	OVALLACION O	
adequately complete this task?		

Questionnaire AT-ORT-3, UIT, Opening/Closing Runways		
Question	Answer	Comments
Q1: AT User's Manual	OK 2	The user's manual as an operational tool is of very
	Shook Band 1	limited use. Quick reference cards at the Mini DCU are
Was the function found easily enough?	Note Pound	the best option for the ops quarters.
Q2: AT User's Manual	O.K 2	Same as above.
	Too Cryptic	
Was the function's entry useful/complete enough?	Incomplete 0	
Q3: Keystrokes	Good	Somewhat Difficult - The 'Enter' moves it right and then
	Useable	'Up'/'Down' becomes an 'Enter'.
Are the function's keystrokes acceptable?	Unacceptable 0	
Q4: Feedback	Ok   3	
	Not Useful	
Was the function's feedback acceptable?	Not Needed 0	
Q5: Training	Yes	
	No 0	
Did AMASS AT Training sufficiently cover this subject?	NA	
Q6: AT Operational Procedures	Ves	Same as Q3 above.
	<b>No</b>	
Does the AMASS provide the commands and controls necessary to	<b>N/A</b>	
adequately complete this task?		

Ouestionnaire AT-ORT-3, UIT, Changing Operational Configurations	
Question	Answer Comments
Q1: AT User's Manual	2
	_
Was the function found easily enough?	Not Found 0 the best option for the ops quarters.
Q2: AT User's Manual	<b>Ok</b> 2 Same as above.
Was the function's entry useful/complete enough?	Too Cryptic 1 Incomplete 0
O3: Keystrokes	
Are the function's Feretralies accentable?	Useable 1
O4: Feedback	
11.12 - 4 6 4 7 7 11 1	
was the function's reedback acceptable?	Not Needed
Q5: Training	
Did AMASS AT Training sufficiently cover this subject?	
O6: AT Onerational Procedures	
	No.
Does the AMASS provide the commands and controls necessary to	$N_{i}$
	Additional Comments
The 'Rain' portion of the Operational Configuration needs to be clarified - as i	needs to be clarified – as it is used for functions other than 'Rain'

Questionnaire A1-OK1-3, U11, Changing to/from a "rain" Operation	"rain" Operational Configuration	
Question	Answer	Comments
Q1: AT User's Manual	( <b>0</b> )k	The user's manual as an operational tool is of very
	Too Hard	limited use. Quick reference cards at the Mini DCU are
Was the function found easily enough?	Not Found 0	the best option for the ops quarters.
Q2: AT User's Manual	0k	Same as above.
	Too Cryptic 1	
Was the function's entry useful/complete enough?	Incomplete	
Q3: Keystrokes	Good 3	
	Useable	
Are the function's keystrokes acceptable?	Unacceptable 0	
Q4: Feedback	Ok.	
	Not Useful 0	
Was the function's feedback acceptable?	Not Needed 0	
Q5: Training	Yes 2	Yes Comment: Need to decide on terminology. Rain or
	No	Limited?
Did AMASS AT Training sufficiently cover this subject?	N/A 0	
		No Comment: Some confusion as the training reflects
		the use of rain selection for uses other
		than rain.
Q6: AT Operational Procedures	Yes	
	ONO CONTRACTOR	
Does the AMASS provide the commands and controls necessary to	<b>N/A</b>	
adequately complete this task?		

Ouestionnaire AT-ORT-3, UIT, Training and Documentation, SHEET 1	Training and Documentation	n, SHEET 1		
	)			
AMASS Menu Mode	Enter AMASS Mode	Move AMASS Alerts Window	Go to ASDE Main Menu	Display AMASS Function Key Summary
Q1: AT User's Manual	0k	2 OK	Ok 2	Ok 2
Was the command found easily	Too Hard	Too Hard	Too Hard	Too Hard
	Not Found (	0 Not Found 0	Not Found 0	Not Found 0
Q2: AT User's Manual	Ok	2 OK	OK 2	Ok 2
Was the command's enfry	Too Cryptic	Too Cryptic	Too Cryptic	Too Cryptic
useful/complete enough?	Incomplete	0 Incomplete 0	Incomplete	Incomplete
Q3: Training	Yes	3 Yes 3	Yes 3	Yes
Did AMASS AT Training	No.	0 No	No	No
adequately cover each listed function?	N/A	0 N/A 0	N/A 0	N/A 0
		Additional Comments		

Questionnaire AT-ORT-3, UIT, Training Documentation, SHEET 2	-ORT-3, UIT, T	raining Docun	nentation, SHE	ET 2						
AMASS Keyboard	Move AMASS	Return to	Display the	Filter all alerts	Filter caution	Enable all alerts	Filter arrival	Enable arrival	Extend Alert	Restore Alert
Commands	Alert window	ASDE	AMASS	on ground track	alerts on ground	on ground	alerts	alerts	Timeout Period	Timeout Period
		Functions	Function Key		tracks	tracks			Stopped Track	Stopped Track
			Summary							
Q1: AT User's Manual	0):	7 <u>0</u> .	0).	0.01	. OK	OR 2	OK 2	( <b>0</b> )k	(a):	0.00
Was the command	ToolHards	Too Hard	Too Bard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard	Too Hard #	Too Hard
found easily enough?	Not Found 0	Not Fourid	Not Found 0	Not Found 0	Not Found 0	Not Found 0	Not Found 0	Not Found 0	Not Found 0	Nov Found
Q2: AT User's Manual	(0)k 2	70	Ok	0)¢	Ok 2	Ok 2	Ok 2	0)?	(C)k 2	2
Was the command's	Too Cryptic	Too Cryptic	Too	Too Cryptic	Too Cryptic	Too 1 Cryptic	Too	Tion	Too Gryptie	- Ja Gryffie
entry useful/complete enough?	Incomplete 0	Incomplete (	Incomplete 0	Incomplete 0	Incomplete 0	Incomplete 0	Incomplete 0	Incomplete 0	heomplete 0	0 அவன்கர்
9-Y Q3: Training	Ye: 2	Yes	Yes	Yes 2	Yes	Yes	Yes 2	768	700	Ye: 2
Did AMASS AT	- - -	No	No a	No	No	No	No	CN	- No.	C
raining adequately cover each listed	0 VW	N/A	0 VM	0 V/V	0 WW	N/A 0	N/A 0	N/A 0	N/A == 0	0 V/V
function?										

Additional Comments
We need a <u>permanent</u> overlay such as a sticker or decal cheat sheet to attach to the mini DCU for the hotkeys.

### APPENDIX L AF OT, MOP/MOAR Result Matrix

## TEST DATA LOG. ႕

Test Date(s): February, 2000
Test Coordinator: Dan Dellmyer
Test Engineer:

	MAOR	PASS/	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP		FAIL			
MOP-5.1 Source: ORD 3.s.(1)	MAOR-5a1: Remote Monitoring Subsystem (RMS): The RMS for the AMASS shall be accomplished via	PASS			
The AMASS shall have a useful life of 20 years, operating 24 hours per day, 7 days a week, with downtime limited to corrective and preventive	the ASDE-3 RMS link. Its status shall also be reported locally at the ASDE-3 maintenance data terminal (MDT).				
	MAOR-5a2: Built-In-Test (BIT)/Fault Isolation Test (FIT): AMASS shall provide both BIT and FIT capability to sense, identify and				
	MAOR-5a3: Local Support Tools: AMASS shall provide the capability to plug in a PC platform monitor,				
	keyboard, and mouse for use within the tower cab to accommodate functions such as system setup, testing, and adaptation modification.				
	MAOR-5a4: Additional connection capabilities shall be provided for the three units (PC platform monitor, keyboard and mouse)adjacent to the AMASS cabinet (i.e., in the				
	equipment room).  MAOR-5a5: One additional connection capability shall be provided for an additional unit (PC platform, keyboard and mouse).				

	MAOR	PASS/	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP		FAIL			
MOP-5.2 Source: ORD 3.s.(2)	MAOR 5.2: The inherent availability, which does not include the ASDE-3 availability or the	PASS			
Inherent Availability (Ai); The inherent availability, which does not include the ASDE-3 availability or	AMASS preventive/scheduled maintenance, must not be less than 0.998 times the Ai for the ASDE-3.				
the AMASS preventive/scheduled maintenance, shall not be less than 0.998 times the Ai for the ASDE-3.					
MOP-5.3: Source: ORD 3.s.(3)	MAOR-5.3: The mission MTBF must be greater than 2190 hours.	PASS			
Mean Time Between Failure (MTBF). The mission MTBF shall be greater than 2190 hours.					
MOP-5.4: Source: ORD 3.s.(4)	MAOR-5.4: The MTTR must not be greater than 30 minutes in the three-	PASS			
Mean Time To Repair (MTTR). The MTTR shall not be greater than 30 minutes in the three-channel	Granici Corriguation.				
configuration.					
MOP-5.5: Source: ORD 3.s.(5)	MAOR-5.5: The maximum PM required during any 6-month period must not exceed 5 hours.	PASS			
Preventive Maintenance (PM). The maximum PM required during any 6-month period shall not exceed 5					
MOP-5.6: Source: ORD 3.s.(6).\$1	MAOR-5.6: The RMS for the AMASS must be accomplished via the ASDE-3 RMS link	PASS			
Remote Monitoring Subsystem (RMS). The RMS for the AMASS shall be accomplished via the ASDE-3 PMS link					
CANAD HIER.					
MOP-5.7: Source: ORD 3.s.(6).\$2 Tre eratine chall also be concreted locally	MAOR-5.7: The AMASS status must also be reported locally at the ASDE 3 maintenance data forminal	PASS			
at the ASDE-3 maintenance data terminal (MDT).	(MDT).				

	MAOR	PASS/	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP		FAIL			:
MOP-5.8: Source: ORD 3.s.(7) Built-In-Test (BIT)/Fault Isolation Test (FIT). AMASS shall provide both BIT and FIT capability to sense, identify, and locate failures.	MAOR-5.8: AMASS must provide both BIT and FIT capability to sense, identify, and locate failures.	PASS			
MOP-5.9: Source: ORD 3.s.(8).\$1 Local Support Tools. AMASS shall provide the capability to plug in a PC platform monitor, keyboard, and mouse for use within the tower cab to accommodate functions such as system setup, testing, and adaptation modification.	MAOR-5.9: AMASS must provide the capability to plug in a PC platform monitor, keyboard, and mouse for use within the tower cab to accommodate functions such as system setup, testing, and adaptation modification.	PASS			
MOP-5.10: Source: ORD 3.s.(8).\$2 Connection capabilities shall be provided for the three units (monitor, keyboard, and mouse) adjacent to the AMASS cabinet (i.e., in the equipment room) and at a location identified by the tower Air Traffic Manager.	MAOR-5.10: Connection capabilities must be provided for the three units (monitor, keyboard, and mouse) adjacent to the AMASS cabinet (i.e., in the equipment room) and at a location identified by the tower Air Traffic Manager.	PASS			
MOP-5.11: Source: ORD 3.s.(9).\$1 Interchangeability. All AMASS equipment shall be constructed with like units, assemblies subassemblies and replaceable parts being physically and functionally interchangeable.	MAOR-5.11: All AMASS equipment must be constructed with like units, assemblies subassemblies and replaceable parts being physically and functionally interchangeable.	FAIL			
MOP-5.12: Source: ORD 3.s.(9).\$2 Modular construction shall be used with a minimum number of item types.	MAOR-5.12; Modular construction must be used with a minimum number of item types.	PASS			

	MAOR	PASS/	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP		FAIL			
MOP-5.13:	MAOR-5.13.1: The AMASS AIU	PASS			
Source: Derived from COI 5	subsystem does not cause any	2			
Integration of the AMASS AIU	maintenance alerts or alarms,				
subsystem into the NAS does not	degradation of displayed data, or				
degrade any NAS system in normal	affect the recording of data to the				
operations, capacity operations, or	following NAS subsystems while it				
degraded mode operations.	is in normal operating mode(s), i.e.				
	operational or test mode.				
	MAOR-5.13.2: The AMASS AIU				
	subsystem does not cause any				
	maintenance alerts or alarms,				
	degradation of displayed data, or				
	affect the recording of data to the				
	following NAS subsystems while it				
	is processing a capacity scenario.				
	MAOR-5.13.3: The AMASS AIU				
	subsystem does not cause any				
	maintenance alerts or alarms,				
	degradation of displayed data, or				
	affect the recording of data to the				
	following NAS subsystems while it				
	is operating in a degraded mode.				

PRIORITY			
PROPOSED SOLUTION		<u>-</u>	
ISSUE			
PASS/	FAIL	PASS	PASS
MAOR		MAOR-5.14.1: The integration of the AMASS display features into the ASDE-3 display subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is in normal operating mode(s), i.e. operational or test mode.  MAOR-5.14.2: The integration of the AMASS display features into the ASDE-3 display subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is processing a capacity scenario.  MAOR-5.14.3: The integration of the AMASS display features into the ASDE-3 display subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is operating in a degraded mode.	MAOR-5.15.1: The integration of the AMASS RMS into the ASDE-3 RMS subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is in normal operating mode(s), i.e. operational or test mode.  MAOR-5.1.2: The integration of the AMASS RMS into the ASDE-3 RMS subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is processing a capacity scenario.  MAOR-5.1.5.3: The integration of the AMASS RMS into the ASDE-3 RMS subsystem does not cause any maintenance alerts/alarms or degradation of displayed data while it is operating in a degraded mode.
	MOP	MOP-5.14: Source: Derived from COI 5 Integration of the AMASS display features onto the ASDE-3 display subsystem does not degrade any NAS system in normal operations, capacity operations, or degraded mode operations.	MOP-5.15: Source: Derived from COI 5 Integration of the AMASS RMS into the ASDE-3 RMS subsystem does not degrade any NAS system in normal operations, capacity operations or degraded mode operations. (derived from COI 5 and the AMS T&E process guidelines)

	MAOR	PASS/	ISSUE	PROPOSED SOLUTION	PRIORITY
MOP		FAIL			
MOP-1.19:	MAOR-1.19: AMASS	DACC			
Source: ORD 3.r.(2).(a).\$2	accommodates data from either	CONT			
	ASDE-3 channel.				
AMASS shall accommodate target					
data from either channel of the					
ASDE-3.					

### APPENDIX M

AF OT, AF Questionnaires (February 1999)

### AFO-2, AF Questionnaires

AMASS LRU Name: RF Filter Box Assembly, PC Platform extender transmitter and receiver, Fixed hard drive, Removable disk, Voice processor, Amp/speaker, Computer Interface module, PC platform, Modem, Micro-bus interface, Power monitor, Display processor interface card,	Recommendations  a. Technician #1  b. Technician #2  c. Technician #3
Q1 LRU Replacement  Was the LRU removal and replacement procedure described in a suitable and efficient manner?	a. Redundant and takes a lot for granted. Removal of some items such as pins (spring loaded) not very descriptive.
Q2 AMASS Maintenance Section  Is the AMASS Maintenance section detailed and comprehensive enough to troubleshoot and fault isolate, to the defective LRU?	<ul> <li>a. Fault flow diagrams and equipment names don't necessarily follow block equipment names, very hard to follow and find specifics such as equipment names in tech manual.</li> <li>b. Fault logic diagram needs to indicate a figure number to return to on Figure 7-5. See blocks: Perform AC&amp;DC power fault isolation</li> </ul>
Q3 AMASS Maintenance Section  Is the AMASS Maintenance section detailed and comprehensive enough to assist you in physically locating the LRUs?	a. Definitely not, equipment LRU names are not consistent throughout tech manual     b. Site selected installation of speaker/amplifier assembly.
Q4 AMASS Maintenance Section  Is the AMASS maintenance section detailed and comprehensive enough to assist you in replacing the LRUs?	a. Redundancy. Equipment very hard to access if equipment cabinet is located against the wall.

Q5 Training Effectiveness	a. Still could use OS-2 and Windows 95 overview for file management.
Was the training provided to you (system overview, manuals, system), sufficient to use the AMASS system in an operational environment?	b. Will be attending equipment school in OKC when available.
Q6 System Setup Training Effectiveness  Was the training provided to you, sufficient to use the AMASS manuals and system to perform a setup, data collection, or calibration on this AMASS system?	a. Data collection and clutter map collection not expressed
Q7 AMASS Software User's Manual  Is the AMASS Software User's Manual detailed and comprehensive enough to assist you in the operation and setup of the AMASS system?	<ul> <li>a. I'm not a so called expert in this phase, so I really can't comment</li> <li>a. Table 7-1, which was referenced by the flow chart troubleshooting referred to AMI-Diagnosis. Where is this found?</li> </ul>
Q8 BIT/FIT  Was the Built-in-test (BIT) and Fault-isolation-test (FIT) sufficient in providing guidance to the faulty LRU?	a. Not necessarily  b. With the PC expander (Rx) broken, the maintenance terminal is blank. You must depend on the fault logic diagram.
Q9 Support Equipment  Were you informed of the support equipment requirements for AMASS LRU removal and replacement before beginning the maintenance task? (Tools, manuals, etc.)	a. Absolutely not

### Q10.- Overall System Safety

Do the test tools, AMASS documentation, system or procedures allow you to perform this LRU removal and replacement in a safe manner?

- a. Sometimes it tells you to pull the plug on the 208V. Pulling the plug on the 115Vdisabling the light, which is needed.
- a. All procedures should state unplugging 208VAC from cabinet. Unplugging 115VAC removes just the light (which is needed) and the receptacles at the base of the equipment, which may be needed for test equipment.
- b. Procedure has you secure power at the A/C power switch on the front panel. The procedure should have you secure power by unplugging cabinet or secure circuit breaker.

Additional comments/suggestions regarding AMASS LRU removal and replacement:

- a. Removal and replacement of LRUs are very unsatisfactory in an environment where the AMASS cabinet is located against the wall. Use of a mirror, body contortions, feeling method and removal of unnecessary LRUs to gain access to the failed unit is very time consuming and can be somewhat destructive.
- b. No comments

### c. Documentation

The AMASS troubleshooting charts did not lead me to the cause in any of the four problems I was given to solve. I was never directed, by the charts, to observe either the RMST AMASS inquiry screens, the AMASS application screen for status, or POST FIT results. In fact, I was led to unnecessary removal and replacement of components <u>several</u> times. Only after loosely interpreting the charts, was I once led to run FIT which gave the correct result (with exception, see note). Before starting each of the troubleshooting problems, I made quick cursory observations of the ASDE and AMASS screens and was able to correctly determine the probable cause in each case. The charts actually caused extended outage and I personally would have abandoned their use after the first few moments in favor of my independent observations. There were instances of contradiction as when the AMASS display indicated an LRU (DP1/DM1) had passed POST (or in some cases, displayed blank status field) but failed the FIT results returned to the RMST (this being the true condition). Running FIT manually did not remedy the situation nor did replacing DP1/DM1 as suggested.

Note: Found AMASS TAIU comm fault. Ran FIT, which correctly identified the modem as the defective component. The modem was replaced and operated normally. Ran FIT again to verify operation. FIT erroneously returned a failure with probable causes of 1) serial card, 2)-voice processor, and 3)-comp if. Ran FIT one more time with no failure found.

The 'Table of Contents' is incomplete. Several LRUs (all of the A2 Card Rack Assembly CCAs) were not listed in the removal and replacement procedures. Other maintenance procedures were difficult to find and usually required browsing the List of Illustrations for the LRU with the assumption that the required procedure would be located near the figure. Incorporating a simple index in the documentation would greatly enhance efficiency in field operations.

### Hardware

Access from the front of the cabinet for the CPU, video switch, and modem is nearly impossible. Replacement procedures were crude and cumbersome. For example, the video switch must be unsecured and rested on the unprotected (open cabling and backplane) units below to accommodate CPU chassis removal. Cable routing further complicated the procedures as there was barely enough length to accommodate the re-connection of the cables. These situations can easily contribute to component damage. Re-positioning of the modem to the very top of the rack with the video switch next and the CPU at the lowest available space could elevate an impossible task to a difficult one. Cabling needs serious attention - especially for 'front access sites only'.

### Software

The command 'Sysres -Amass' is only valid while the application is running in 'Operational Mode' but initiating the command at the RMST returns 'System Command Processed' regardless of Amass status. This invalid response appears to occur with all RMST generated commands. A second example would be the command 'Amass -Online' entered before the FIT results have been returned to the RMST - the command was ignored (unbuffered) and a misleading 'System Command Processed' message was displayed.

AMASS Maintenance Procedures: Dedicated Clutter Collect, Load recorded log file, Load current log file, Data reduction utilities, Site-specific file back-up procedures	Recommendations/The problem is
Q1 AMASS Maintenance	a. Picture with no written procedures.
Procedures	No position proceedings through the processor around the file of the life of t
Is the training and AMASS manuals detailed and comprehensive enough to provide you with a functional and operational overview of the AMASS system?	a. No written procedure, though the program seemed user friendly although could not load current log file
Q2 AMASS Documentation	
Is the AMASS documentation	
detailed and comprehensive	
enough to allow you to perform	
routine maintenance tasks on the AMASS system?	
the Awass system:	
Q3 AMASS Configuration	
Is the documentation and	
training of sufficient detail to	
allow you to perform an	
operational configuration	
change? (Workstation mode change, load recorded log file,	
inject synthetic tracks, etc.)	
1	
O4 Dedicated Clutter	h Manu references are incorrect. Some of the stone of the
Q4 Dedicated Clutter Collect	b. Many references are incorrect. Some of the steps are confusing and the procedure ends before instructing you to return thresholds to normal and restoring normal operations
Is the Dedicated Clutter Collect	
procedure described in a	
suitable and appropriate manner?	
manio:	
Q5 Support Equipment	
Were you informed of the	
support equipment requirements	
for the AMASS maintenance	
before beginning the	
maintenance task? (Tools,	
manuals, etc.)	

Q6.- AMASS Maintenance Procedures

Is the AMASS maintenance section detailed and comprehensive enough to troubleshoot, isolate, and reconfigure the system upon locating a fault in the Display Processing Unit (DPU) cabinet?

Additional comments/suggestions regarding AMASS Maintenance Procedures:

- a. Write procedure (step by step) for loading recorded log file for playback.
- b. Write procedure for renaming and saving current log file for access. Consider file management training
- c. While in 'test:on' mode, all synthetically generated targets and alarms are also present in the tower cab and manual suppression of each display and aural alarms is necessary. While this is an undesirable situation, it is workable but should at least include a cautionary statement in the procedure.

There were no detailed contiguous procedures for data playback and required searching the documentation and several empirical iterations to accomplish the basic task.

Invoking the 'AMASS MT' mode (amass -disconnect), causes an ASDE fault.

No scenario for arrival alarms other than real-time arrival target with stopped synthetic target.

There are no site specific file or critical file backup procedures.

There are no data reduction utilities.

Incomplete and incorrect clutter map procedures.

Terminal Automation Interface Unit (TAIU) Comments

Technician a. Most LRUs were more or less obvious to what needed to be removed.

- b. The two days spent getting familiar with the TAIU were sufficient to get an overall understanding of the functionality. Troubleshooting flow chart (page C-3 of 8) refers to ARTS interface (primary/secondary IOP channel). At this location, the radar technicians don't work on the ARTS.
- c. OJT training was adequate in scope but should be limited to 2 or 3 persons per session. I was not able to see the displays or controls most of the time because of the number of people gathered in the limited space of the ARTS environment.

The TAIU troubleshooting charts were acceptable and I was taken to the correct result each time. Consideration should be given to switching IOP interfaces to aid the process. The modem configuration procedure addresses only 'Idle or Training' and not the 'Online' condition. There were obvious places in the charts where paragraph references would have been very useful.

### TAIU Documentation

The flow chart for IOP repeater amplifier needs to have a couple of blocks before the block "Call for assistance."

Add a block to check ODS for IOP configuration.

Question: Configured ok?

If the answer is Yes - Change to secondary IOP.

Question: Are FPU data blocks now present?

If the answer is Yes – Interchange IOP repeaters to isolate faulty unit.

If the answer is No – Reconfigure ODS correctly.

Question: Are FPU data blocks now present?

If the answer is Yes – the problem is solved.

If the answer is No – then you return to the previous block where the ODS is configured properly and proceed.

If the answer is No after changing to the secondary IOP, this is where the Cal for assistance block goes.

Make very clear whom the technician is to call.

### APPENDIX N

AF OT Issue Result Matrix

# AMASS AT OT ISSUE LIST

For the issues identified below, criticality has been defined as follows:

- High A problem that will prevent, degrade, or interrupt operational service or jeopardize safety, and has no acceptable workaround.
- Medium To prevent, degrade, or interrupt operational service or jeopardize safety, but has an acceptable work-around.
- Low The issue constitutes an improvement to the operational use of AMASS and can be resolved through postcommissioning modifications.

ISSUE	TITLE	DESCRIPTION	REGRESSION TEST PASS/FAIL	REMARKS/STATUS	
1.A	Documentation	The maintenance manual lacks consistency in naming (i.e. initialization process, boot-up, and power-on self-test).	PASS		
1.B	Documentation	AMASS troubleshooting flowcharts should include blocks to observe the AMASS MT, RMST and FIT results.	PASS		
1.C	Documentation	The table of contents is incomplete with many of the A2 CCAs not listed as LRUs.	PASS		
1.D	Documentation	Each listed LRU should have the equipment reference number (i.e. A2A4, A1A7, etc.) following the title and all should be included in an index.	PASS		
1.E	Documentation	Required procedures should be located near or with the figures, which would increase end-user efficiency.	PASS		
1.F	Documentation	The User's manual does not list how to perform a dedicated clutter collect in the AMASS TIB and once found in the manual it is inaccurate and incomplete.	PASS		
1.G	Documentation	No procedure is available to make site-specific files, or to backup critical files.	PASS		
1.H	Documentation	No procedure is available to save or playback the current log file.	PASS		
1.1	Documentation	Table of Contents is very difficult to read and hard to find an item quickly. Need to make sections standout	PASS		

1.5	Documentation	Create a separate index volume.	PASS	Table of Contents was created by
1.K	Documentation	AMASS BIT Screen from the RMST should be used in the Flow Charts	N/A	AF Tech. need to run FIT and not rely on the BIT information.
2	LRU Replacement (Medium)	Access from the front of the cabinet for the CPU, video switch, and modem is nearly impossible. Cable dressing complicated the R&R procedures, with cable ties having to be cut to facilitate removal of equipment. Use of a mirror, body contortions, feeling method and removal of other LRUs to gain access is time consuming and could be damaging.	FAIL	STR has been written.
3	Site Installs	Future site installations need to address providing rear accessibility.	PASS	AMASS sites will have access from the rear of the cabinet.
4	Spares	As yet, a finalized spares and LRU list has not been completed. LRUs for the OT were selected as a best guess. An agreed LRU and spares philosophy is a requirement for successful NAS integration	PASS	Logistics needs to submit a finalized spare and LRU philosophy  Status: Final LRU list has been submitted.
5	Certification	Three separate discussions were held regarding certification. An agreed philosophy was presented but procedures are not currently in place.	PASS	Certification Procedures were tested at DTW, with only minor red lines required.  See comments
9	Single Point of Failure	Technicians are concerned with AMASS designated as being a reportable system.	PASS	AMASS system is classified as an essential system.
7	Training	The technicians believed the system overview to adequate, however a full training course on AMASS is forthcoming. Training for the TAIU system was approved on site by AFZ. Windows, OS-2 and DOS training were brought up as issues.	PASS	Status: A separate course will be developed for OS-2 Operating system.
∞	Data Reduction	There is nothing in either manual regarding how to copy log files to the removable drive.	PASS	TIB includes procedures on how to copy log files.
6	Safety	Procedure for removal and replacement of the RF Filter Box assembly instructs you to secure power at the <i>alc</i> power switch. Power needs to be secured at the circuit breaker or by unplugging the cabinet.	PASS	AF Reviewed the procedure
10	Video Stitching	AMASS is generating a video stitching on the ASDE-3 Display.	FAIL	Modify the AMASS equipment to resolve the video timing issue.

### APPENDIX O

AF OT, AF Regression Comments (June 2000)

### **AF Comments to the AMASS Manuals**

### I. Comments to the AMASS TIB

1. Problem: The format of the AMASS instruction book title page is not clear.

Solution: Reverse the title page format

- a. Move AMASS Addendum to top of page in same bold print as ASDE
- b. Move the ASDE where the AMASS is now and use the smaller print.
- Problem: TABLE OF CONTENTS Very hard to find an item quickly. Need to make the various sections standout. Also the Technicians were having problems looking up detailed information in the AMASS TIB.

### Solution:

- a. Add an A to Volume numbers i.e. Volume 7A
- b. Separate Section and Sub-Section Titles with a space at top
- c. Capitalize Section and Sub-Section Titles
- d. Use indentation under Section Titles and Sub-Section Titles

### Example:

- 3.0 OPERATION
  - 3.1 POWER SYSTEM UP
  - 3.2 CONTROLS AND INDICATORS
    - 3.2.1 Cabinet Controls and Indicators
    - 3.2.2 Operational Display Unit (ODU)

### 4.0 POST-OPERATION

- e. *One possible solution:* Creating A SEPARATE INDEX VOLUME may help the technicians to find an item quickly.
- 3. Problem: No Boot Sequence for AMASS/ASDE in the AMASS TIB Manual could be found. If ASDE is powered down, what is the sequence of events, do you power down AMASS, then power up ASDE first or visa versus. This information is contained in the change pages for the ASDE but should also go into the AMASS TIB. Should this be located in a AMASS TIB flow chart diagram?
- 4. Overall Comment: The AMASS TIB's should clearly defined in the procedures when the Technician should use AMASS MT or the ASDE MT with the appropriate commands for AMASS disconnect.
- 5. Problem: POWER DOWN/POWER UP missing steps in the procedure.

Solution: Last step should be added "Reset -System". This is needed to clear the stored faults

- 6. Problem: COPY LOG FILES page 7.10.50 routine did work, Solution: Add to the first step "FROM ASDE MT TYPE: AMASS –DISCONNECT"
- 7. Problem: PLAYBACK routine did work

### Solution:

a. Path must be specified where to put it

- b. Instructions do not tell how to get out of playback. Add step to say "go to system select mode, select operational"
- 8. Problem: DEDICATED CLUTTER COLLECT routine did work

### Solution:

- a. Page 7.10.61, "Menu Path: System> Dedicated Clutter Collect" the word "system" (AMASS or ASDE?) keeps changing throughout the book. This needs to be made uniform.
- b. Page 7.10.62 -top sentence remove "weather conditions" or "off more than one hour." Be more specific: If there is no reason for field personnel to perform this procedure. Then we should consider stating that because this requires power down/power up, it is a big interruption.
- c. Command "AMASS-DISCONNECT" causes AMASS fault but there is no fault. There should be a difference noted on the screen between a keyboard command to disconnect and an actual fault that causes a disconnect
- d. Page 7.10.62 AMASS Terminal, under Step 2 add sub step c. to read "There is a short wait for automatic clutter window to appear."
- e. Step 5 should reference Shut Down Procedures, Volume 1, page 1.3.36, paragraph 3.44
- f. Step 6 Rewrite to read "ASDE needs to be returned to facility Area 12 Threshold values and the IF Thresholds turned "ON."
- 9. *Problem:* COPY BACKUP SITE DATA/ DATABASE FILES page 7.10.215, When copying the DTW\_DATA Folder over to the F drive there was NOT enough capacity.

Solution: Create a separate folder for each the Site Configuration files and the Log Files or write a script file to copy only the site configuration files.

- 10. Faulted speaker amplifier, disconnected cable at the top of AMASS cabinet Maintenance Mode
  - 1. *Problem:* Figure 7-1, troubleshooting flow chart assumes that the AMASS is connected to the ASDE RMST after rebooting the AMASS system.

No resolution required: In AMASS Configuration file the following line was commented out:

Control\_Mode = MT

MT = AMASS MT Only

RMS = Connect AMASS to ASDE RMS


therefore, the AMASS would not auto connect to the ASDE RMST on reboot. During normal operations, the AMASS will auto connect to the ASDE RMST on reboot.

2. *Problem:* The technicians thought if you incorporate the "check AMASS BIT results on the ASDE MT Inquiry screen first" into the Troubleshooting flow charts. This could find the problem immediately. Then run the Fit at the ASDE MT.

Solution: FIT runs a more detailed fault testing then BIT provides, solution is to run FIT each time. A detailed note in the AMASS TIB Manuals and the training class should stress the use of running FIT instead of relying on BIT.

Side Note - FIT should always be run after a clean boot, if you just run FIT (no AMASS Reboot) then FIT program will use the previous history and may provide the wrong information.

3. *Problem:* Technicians were having a difficult time following the flow charts, when ask to return back to Figure 7-1.

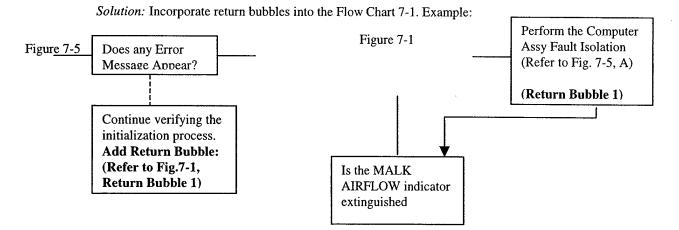

### **II COMMENTS TO TAIU TIB**

- 1. No procedure in TAIU TI manual Section 5.2.e to set the system clocks. This has been designated as a certification requirement in (AF Certification Procedures) Section 1, Performance Checks, 411.d.1.
- 2. Section 5.2.e maintenance checks: reference illustrations/pictures of the various systems when available.

### III COMMENTS TO THE CERTIFICATION PROCEDURES 6330.5A

### A. TAIU

- 1. Section 1, Performance Checks, 411.d.1change paragraph 5.2.a to 5.1.
- 2. Section 1, Performance Checks, 411.d.1change paragraph 525 to 528
- 3. Section 11, TAIU, 396, change paragraph 525 to 528
- 4. Paragraph 528, Checking the Altimeter omit calling ATC to get an altimeter reading from Step 5. This will be an annoyance to ATC and is unnecessary. The best procedure is to check the DASI; next best is to check the DEDS for altimeter reading
- 5. Section 1, Performance Checks, 412.i.3, Computer Power Supply change paragraph 526 to 529
- 6. Paragraph 529, Procedure should refer technician to rear of cabinet where power supplies are located. The LEDs are on the power supplies.
  - Side Note 3/2/2000, DI will be replacing the power supplies in the TAIU Cabinet, and the new power supplies have no LEDs.
- 7. Paragraph 529 Step B, Need to make reference to Illustration on p.15 of 15, Appendix A of the TAIU TI Manual.
- 8. Section 1, Performance Checks, 414, if available in the TAIU TI Manual should make reference to Illustration showing grills and filters

### **B** AMASS

- 1. Section 1, Performance Checks, 410.b, Change maintenance procedures paragraph from 527 to 530
- 2. Change Paragraph 530.d Step 1 & 12 to "At an ODU in the air traffic control tower cab, go to ASDE main Menu, scroll to the AMASS function, activate the AMASS Main menu."

- 3. Add a statement to Paragraph 530.d Step 11 on "AMASS may not alert immediately due to the amount of time required for AMASS to process the closure of a runway."
- 4. Change Paragraph 530.d Step 21: replace "active" to "open". Change "an X" to "No X" and change "each" to "either".
- 5. Add Step 22 "To toggle to ASDE Menu Depress Function U Enter, then Scroll to Exit Enter",
- 6. Section 1, Performance Checks, 412.h, Quarterly add step 3, "Check fans on PC Platform."

### C. ASDE

Page 3-2, paragraph 311 to 317, ASDE Handbook manual paragraph references are correct, but the Site Manual has not been updated. Why two references?

### D. Appendix I Certification Requirements, Table 1

- 1. SIA Incursion Alert Test change reference paragraph 527 to 530
- 2. Acronym TSGDT Description is wrong, needs to be changed to TSSDD throughout table.